

Seat adjustment switch inoperative LIN communication

Topic number	LI82.00-P-080029
Version	1
Function group	82.00 - General
Date	3/9/26
Validity	206, 214, 223, 236, 254, 294, 295, 296, 297 from Start of Production
Reason for change	

Complaint

The seat may no longer be adjustable using the electric seat adjustment switch on the door module.

No related error is stored in the quick test.

Cause

Under certain conditions, the electric seat adjustment switch may remain in sleep mode. It is then not possible to adjust the seat using this switch. This is a software error.

Remedy

To restore functionality, perform the following steps:

1. Remove the door trim from the affected door.
2. Unplug and reconnect the plug of the electric seat adjustment switch (No. 2 in the picture in work instruction AR91.29-P-2522WT) to perform a reset of the switch.

Note: The switch does not need to be removed for this.

3. To prevent this problem from recurring, the current software version A2239029930 should be installed on the switch module "Seat Adjustment Switch Group ...".

Example: S22 - Select S22 – "Seat Adjustment Switch Group, front left" (SSE-VL) → Adaptations → Control unit update → Update control unit software.

If the vehicle already has SW version A2239029930, there is another cause.

Please open a TIPS case to the Body/Chassis/Entertainment inbox if the issue persists with the new software installed.

WIS-References		
Document number	Title	Note

AR72.10-P-6575WT	Remove/install door panel	Instructions Example MRA2
AR91.29-P-2522WT	Remove/install electric seat adjustment switch	First, remove the door trim. Note: The switch does not need to be removed; simply unplug connector "2" in the picture and plug it back in after a few seconds. Example MRA2

Disclaimer

NOTE: The information contained in this document is intended for use by trained, professional technicians with the knowledge to properly and safely perform diagnosis and repairs on Mercedes-Benz vehicles, using Mercedes-Benz approved tools and equipment. It informs service technicians about conditions that could occur in certain vehicles and provides information that could assist in proper vehicle diagnosis, service, or repair. It does not indicate that a defect is present in any vehicle referenced in this document nor does it imply warranty coverage. DO NOT assume that a symptom or condition, or a described cause of a symptom or condition, affects any particular vehicle or groups of vehicles, or that a described repair applies to any particular vehicle or groups of vehicles. There can be multiple causes resulting in the same or similar symptoms or conditions described in this document, and trained professional service technicians must use their diagnostic skills to make evaluations on a case-by-case basis. The information contained in this document does not guarantee warranty coverage nor does it extend the vehicle's warranty in any way.

Symptoms

Body > Seat > Seat adjustment > Function error

Body > Interior equipment > Switches, interior, general > Malfunction

Operation numbers/damage codes

Op. no.	Operation text	Time	Damage code	Note
		H	82F05	
		H	82F07	
		H	82U05	
		H	82U07	
		H	82B21	
		H	82B22	
		H	82P21	
		H	82P22	