



## **SSM 54656 2025-2026 F-150 - "Check 4x4" Message - Four-Wheel Drive Mode 4L Switch Stuck On With DTC U2002:9E Stored In The ATCM - Built On 01-Oct-2025 And Through 15-Dec-2025**

Some 2025-2026 F-150 vehicles built on 01-Oct-2025 and through 15-Dec-2025 may exhibit a "Check 4x4" message with diagnostic trouble code (DTC) U2002:9E stored in the all terrain control module (ATCM). This may be due to the 4L switch being stuck on due to excess material on the lower center instrument panel trim panel keeping the switch depressed. To correct the condition, replace the lower center instrument panel trim panel. Refer to Workshop Manual (WSM), Section 412-00 > Removal and Installation > Heating, Ventilation and Air Conditioning (HVAC) Control Module for reference of all hidden fasteners. For claiming, use causal part 15042C74 and labor operation MT15042C74SSM up to 1.3 hours.