



Security Light Wiring

Bulletin Type:	TSB	Publication Date:	March 2026
Bulletin #(s):	26-008	Make(s):	Entegra Coach
Job Code(s):	9803649	Model(s):	Centurion
Flat Rate(s):	9803649 – .30 HR – Security Light rewire and replacement	Model Year(s):	2026

Incident:	Security Light was wired incorrectly causing the light to function improperly
Affected Units:	2026 Entegra Coach Centurions
Parts Kit: 26-008EC	Parts Kit #: 26-008EC 1 Qty –LIGHT,SCTY 14.25X2.00 LED BLK W/MOTION SNSR 3 Qty – TERMINAL,BUTT 14-16GA INSUL BLU
Misc. Tools & Supplies:	Screw Gun with Square head bit Wire Strippers Wire Crimpers (Terminal crimp/application tool/Sta-kon crimper) Putty Knife (Optional)
Parts Return Information:	N/A

**WARNING**


Indicates a potentially hazardous situation that, if not avoided, may result in death or serious injury.

**WARNING**


Ensure all power to the coach has been disconnected and the coach is fully powered off, prior to starting the repair.

SECURITY LIGHT WIRING REPAIR INSTRUCTIONS


1. Free the exterior light casing/cover from the cap seal and side of the coach. Then remove the exterior casing/cover.
(Figure 1)
 - a. **Note: You can use a putty knife with the cap seal on the light if needed to make removal simpler.**

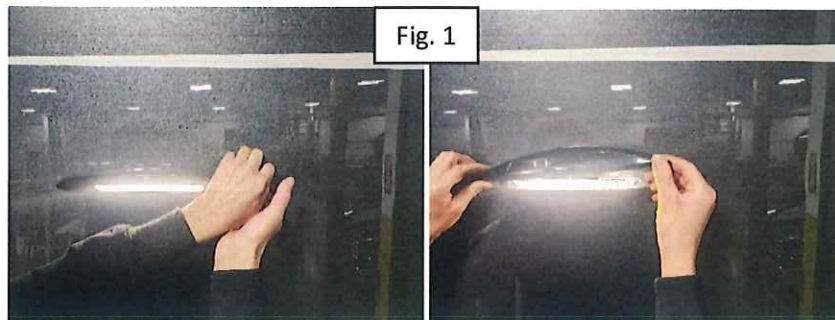


2. Use a screw gun and square head bit to remove the two screws securing the light to the coach. Then remove the light from the coach (Figure 2)

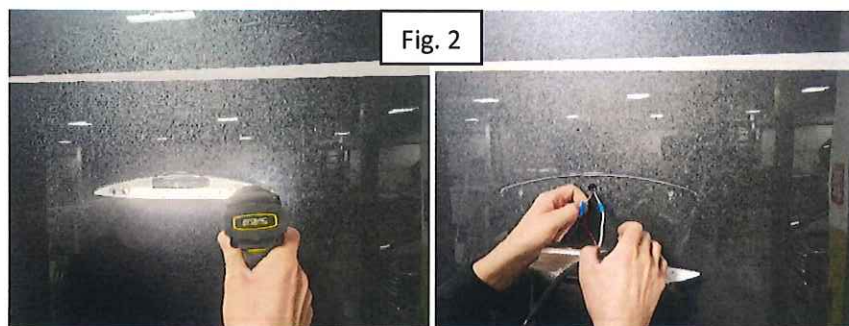


3. Cut the wires, one at a time, before the butt connectors, for the Red (From Light) to White (From Coach), Black (From Light) to Gray with Yellow stripe (From Coach), & White (From Light) to Brown with Red stripe (From Coach). (Figure 3)

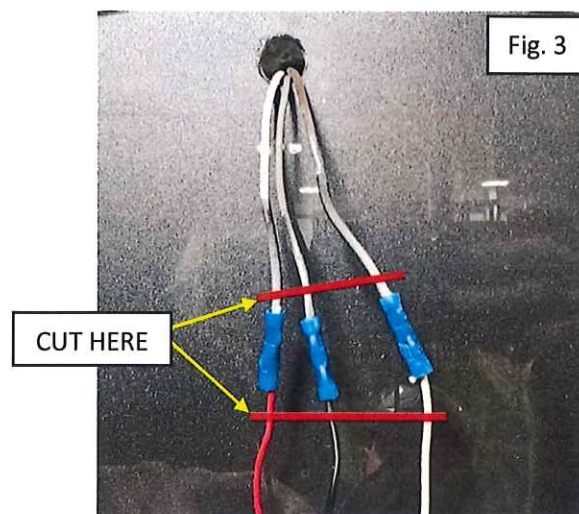


- Strip the wires coming from the coach. (Figure 4)

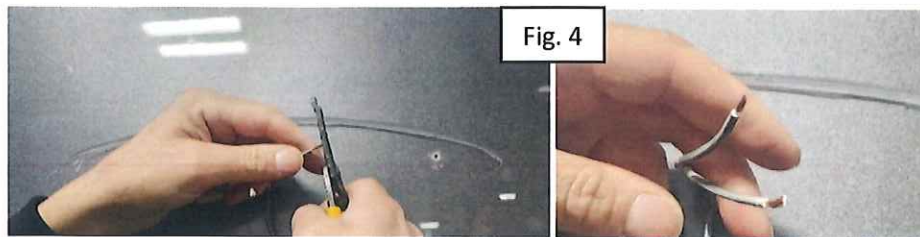


- Use butt connectors to connect the new light to the existing wires from the coach. The Black wire (From Light) will be connected to the White wire (From Coach), the Red wire (From Light) will be connected to the Gray with Yellow Stripe wire (From coach), & the White wire (From Light) will be connected to the Brown with Red stripe wire (From Coach). (Figure 5)

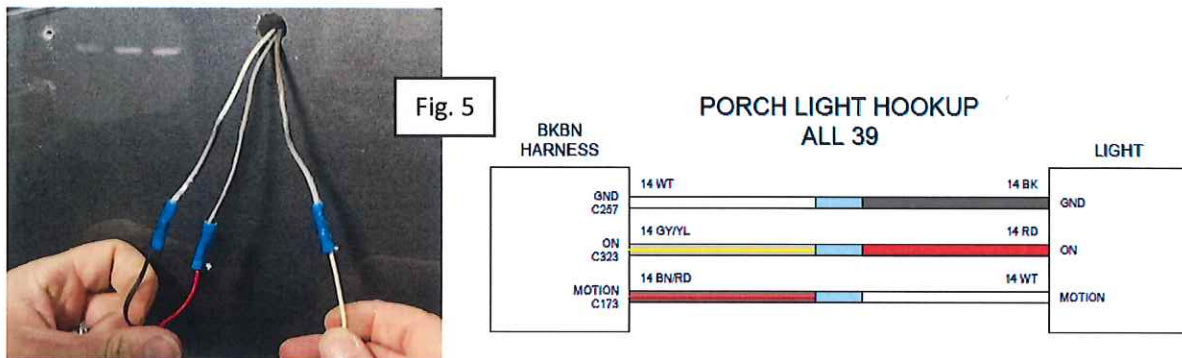

- With the new connections made, run the wiring for the light back into the coach through the wiring hole cut out.
- Resecure the new light to the side of the coach using the 2 fasteners removed previously. (Figure 6)

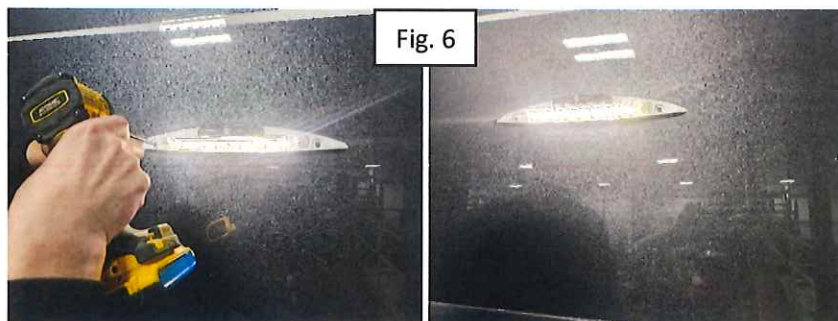

- Snap on the outer light casing/cover. (Figure 7)

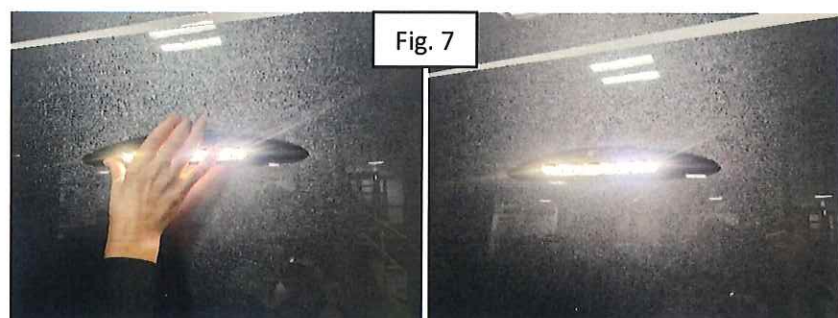

9. Test the light for functionality.

- a. **Note: You will want to test both the Porch and Security Porch lights. They will operate independent of one another.** (Figure 8)

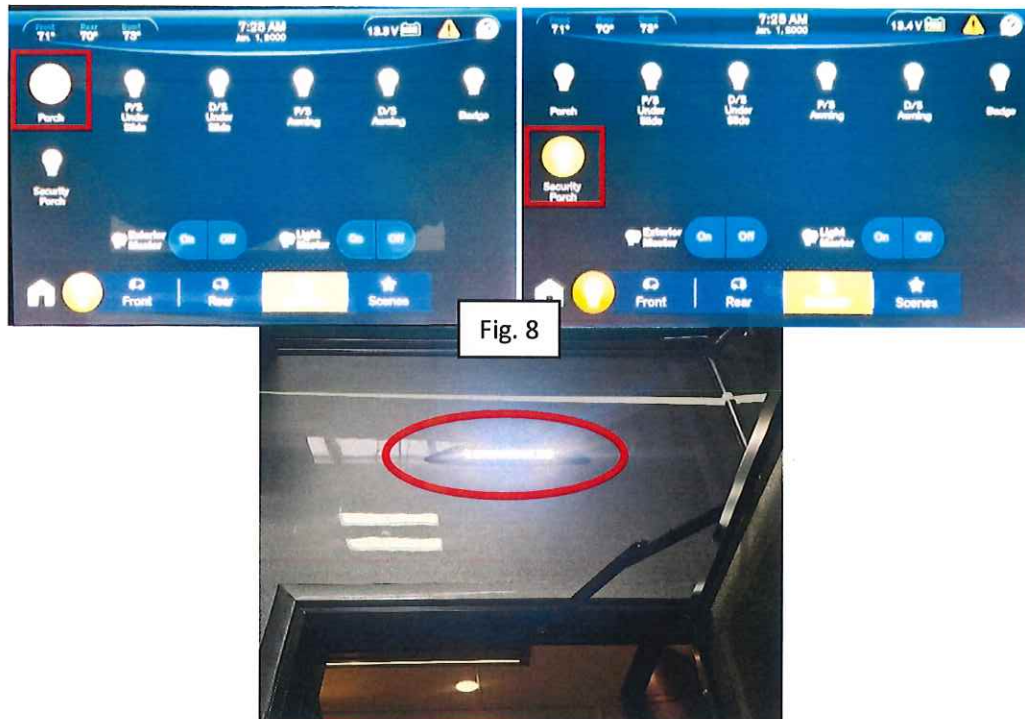


Fig. 8

Jayco's sole obligation under our limited warranty is to repair or replace defective materials and/or workmanship deemed our responsibility as determined by Jayco in our sole discretion. Jayco reserves the right to use new and/or remanufactured parts or materials of similar quality to complete any work, and to make parts and/or design changes as appropriate without notice to anyone. Jayco designs and/or materials changes are done without obligation to incorporate such changes in previously manufactured product. Jayco makes every reasonable effort to ensure field remedies will not adversely affect performance and/or safety of the unit. This field remedy is not intended to extend to future performance of this RV, or any of its materials, components or parts beyond the standard warranty period. The RV owner's obligation to notify Jayco, or one of its independent, authorized dealers, of a claimed defect does not modify any obligation placed on the RV owner to contact Jayco directly when attempting to pursue remedies under state or federal law.

903 South Main Street • P.O. Box 460 • Middlebury, IN 46540



Technical Service Bulletin Notification TSB #: 26-008

Unit Serial Number: DEVICEID

March 2026

«Name»

«Address»

«City» «State» «ZIP»

Dear Valued Dealer,

Jayco has determined that certain 2026 Entegra Coach Centurions have an issue with the security light. The security light was wired incorrectly causing the light to function improperly. The remedy is to rewire and replace the security light.

Our records indicate that the following vehicle is currently part of the inventory at your dealership and requires the Service Bulletin repair prior to being retail sold:

DEVICEID»

If you have sold this affected vehicle, please contact the current owner regarding this Service Bulletin and process the Warranty Registration for them. All pertinent information regarding this Service Bulletin is on file under the Case 26-008 TSB Lines in Jayco Partners.

If you have questions regarding this Service Bulletin, please contact the Jayco Customer Service Department at 800-283-8267.

Sincerely,
Jayco Motorized Division



Technical Service Bulletin Notification TSB #: 26-008

Unit Serial Number: DEVICEID»

March 2026

«Name»

«Address»

«City» «State» «ZIP»

Dear Valued Customer,

Jayco has determined that certain 2026 Entegra Coach Centurions have an issue with the security light. The security light was wired incorrectly causing the light to function improperly. The remedy is to rewire and replace the security light.

Our records indicate that your vehicle is affected by this Service Bulletin. Please contact your nearest Jayco dealer to schedule an appointment. Present this letter as authorization to have the procedure completed at no cost to you.

«DEVICEID»

If you have sold or traded your vehicle, or for any reason cannot have this service performed, please contact the Jayco Motorized Customer Service Department at 800-283-8267.

We apologize for any inconvenience or concern this bulletin may cause and want to assure you that Jayco is taking all the necessary steps to ensure our product quality meets your expectations.

Sincerely,
Jayco Motorized Division