



Service Bulletin

Bulletin No.: PIT6496A

Date: March, 2026

PRELIMINARY INFORMATION

Subject: Service Headlight Message With DTC's B1B5F sym49 or B1B60 sym49 set in History

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade	2026		November 12th, 2025	Current	All	All
Cadillac	Escalade ESV	2026		November 12th, 2025	Current	All	All

Involved Region or Country	North America, MEO, Korea, Japan
Condition	Some customers may comment of a "Service Headlamp" message. When checking for DTC's there will be history DTCs B1B5F sym49 and/or B1B60 sym49.
Cause	GM Engineering is investigating.

Correction

Perform the following diagnostic steps:

If the DTCs B1B5F sym49 or B1B60 sym49 are current:

a. Follow SI diagnostics as required.

If the DTC's B1B5F sym49 or B1B60 sym49 are history:

a. Clear history DTCs.

b. Verify that the headlights and auto level function of the headlamp is functioning when the vehicle is started. Do this by covering the ambient light sensor on the dash and visually confirming the vertical (up/down) movement of the headlamp beam pattern and/or interior lenses.

c. Verify that the "service headlamp" message does not appear and no DTCs are set.

d. If the headlights are operating properly with no messages and no DTCs B1B5F sym49 or B1B60 sym49 then return the vehicle to the customer, if not then follow normal SI diagnostics as necessary.

GM Engineering is investigating the source of this message/DTCs B1B5F sym49 or B1B60 sym49 and in the meantime please continue to drive your vehicle.

This PI will be updated or replaced with TSB once a determination has been made.

DO NOT replace headlamp assemblies for history DTCs B1B5F sym49 or B1B60 sym49.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
2081488*	Clear DTCs and verify proper headlight operation	0.3 Hrs.
*This is a unique Labor Operation for Bulletin use only.		

Version	2
Modified	03/17/2026 - Created on 03/19/2026 - Update to the Condition and correction sections

