

Front Emblem

Bulletin Type:	TSB	Publication Date:	March 2026
Bulletin #(s):	26-006	Make(s):	Entegra Coach
Job Code(s):	9803648	Model(s):	Centurion
Flat Rate(s):	9803648 – .75 HR – Front Emblem Securement	Model Year(s):	2026

Incident:	Front Emblem is not properly adhered to fiberglass.
Affected Units:	Certain 2026 Entegra Coach Centurions
Parts Kit:26-006EC	Parts Kit: 26-006EC 1 Qty – BADGE,FR BLK SST LT BX HG 61.13X9.13 2 Qty – TERMINAL,BUTT 14-16GA INSUL BLU
Misc. Tools & Supplies:	Wire Strippers Wire Crimpers (Terminal Crimp/Application Tool/Sta-kon Crimper) Plexus Application Tool Sika Application Tool Putty Knife (Optional)
Parts Return Information:	N/A

FRONT EMBLEM REPLACEMENT INSTRUCTIONS

1. Remove the front emblem from the coach.
 - a. **Note: You can start on either side of the emblem, and you can utilize a putty knife to make removal easier.** (Figure 1)



Fig. 1



WARNING



Indicates a potentially hazardous situation that, if not avoided, may result in death or serious injury.

2. Disconnect the wires between the front emblem and the coach.

3. Clean the surface of the cap from any residue that may be left from the initial emblem.

4. Strip the wires coming from the coach using wire strippers.




WARNING



Ensure all power to the coach has been disconnected and the coach is fully powered off, prior to starting the repair.

- a. **Note: the below images are for reference and are not from the repair. They are only for reference on stripping the wire.** (Figure 2)

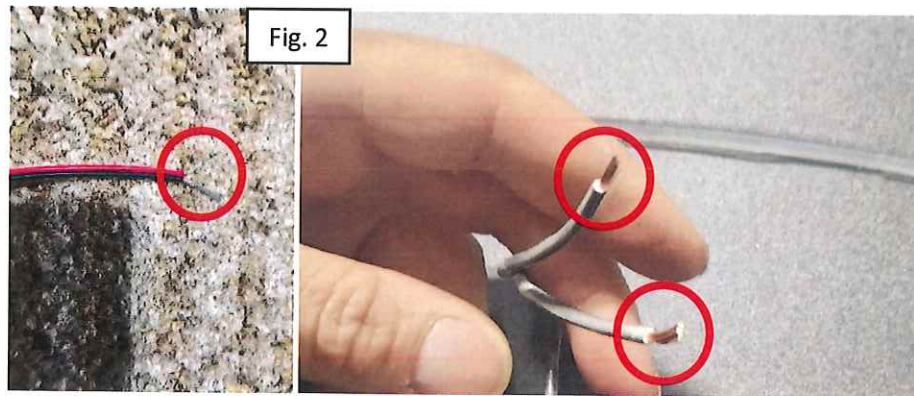


5. Connect the wiring from the new front emblem to the wires in the coach using the butt connectors and a crimping tool. Red wire (From Emblem) to the Blue/Green wire (From Coach) & Black Wire (From Emblem) to the White wire (From Coach).

6. Test light for functionality before installing the new emblem onto the coach.

7. Wipe down the back side of the new emblem with alcohol, let flash.

8. Resecure the new emblem to the front of the coach using Plexus and Sika. The Plexus should be run in 2 beads down the sides of the emblem and 3 or 4 evenly spaced dabs on the top and bottom of the emblem. Sika will be used in between each of the dabs of Plexus on the top and bottom of the emblem. (Figure 3)

9. Let Sika and Plexus adhesives fully cure.

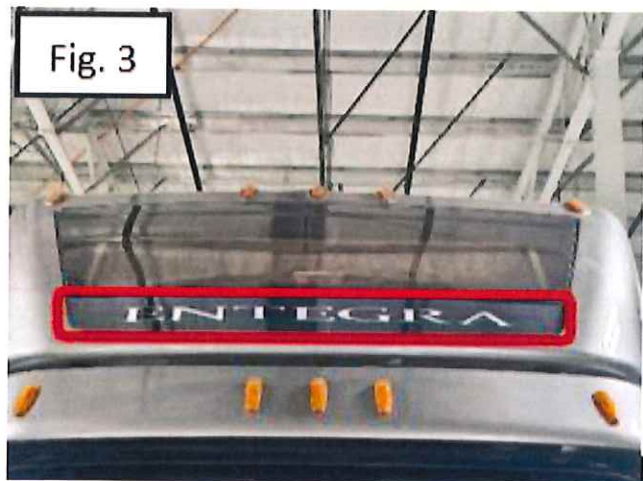

Jayco's sole obligation under our limited warranty is to repair or replace defective materials and/or workmanship deemed our responsibility as determined by Jayco in our sole discretion. Jayco reserves the right to use new and/or remanufactured parts or materials of similar quality to complete any work, and to make parts and/or design changes as appropriate without notice to anyone. Jayco designs and/or materials changes are done without obligation to incorporate such changes in previously manufactured product. Jayco makes every reasonable effort to ensure field remedies will not adversely affect performance and/or safety of the unit. This field remedy is not intended to extend to future performance of this RV, or any of its materials, components or parts beyond the standard warranty period. The RV owner's obligation to notify Jayco, or one of its independent, authorized dealers, of a claimed defect does not modify any obligation placed on the RV owner to contact Jayco directly when attempting to pursue remedies under state or federal law.

903 South Main Street • P.O. Box 460 • Middlebury, IN 46540



Technical Service Bulletin Notification TSB #: 26-006

Unit Serial Number: DEVICEID

March 2026

«Name»

«Address»

«City» «State» «ZIP»

Dear Valued Dealer,

Jayco has determined that certain 2026 Entegra Coach Centurions have an issue with the front emblem. The issue with the front emblem is that it is not properly adhered to fiberglass. The remedy is to replace the emblem.

Our records indicate that the following vehicle is currently part of the inventory at your dealership and requires the Service Bulletin repair prior to being retail sold:

DEVICEID»

If you have sold this affected vehicle, please contact the current owner regarding this Service Bulletin and process the Warranty Registration for them. All pertinent information regarding this Service Bulletin is on file under the Case 26-006 TSB Lines in Jayco Partners.

If you have questions regarding this Service Bulletin, please contact the Jayco Customer Service Department at 800-283-8267.

Sincerely,
Jayco Motorized Division