



Service Bulletin

Bulletin No.: PIT6479A

Date: March, 2026

PRELIMINARY INFORMATION

Subject: U3000 Sym 92 Setting Current or History in K47 Rear Drive Control Module

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Enclave	2025 -2026		ALL	ALL	ALL	ALL
Chevrolet	Traverse	2024 -2026		ALL	ALL	LK0	ALL
GMC	Acadia	2024 -2026		ALL	ALL	ALL	ALL

Involved Region or Country	North America
Additional Options (RPO)	F48
Condition	At initial ignition on the customer may get a "Service All Wheel Drive" or "Service 4WD" message on the DIC. The customer may also comment that the all-wheel drive system is not working. On inspection technicians may find U3000 Sym 92 set as a current or history code.
Cause	Engineering is currently investigating

Correction

Do Not Replace The K47 Rear Drive Control Module for this condition as it will not resolve the concern.

Disconnect the battery for 20 minutes to reset the module.

Reconnect the battery and perform a full vehicle power up/down cycle.

Log into GDS2 and clear all diagnostic trouble codes.

Return the vehicle to the customer.

Advise the customer that they may continue to drive the vehicle, but this may occur again until the software fix is available. (the fault may or may not return)

Note: A new module will not resolve the concern and will function the same way. The reset above will clear the code and recover AWD functionality until the fault occurs again.(the fault may or may not return)

Advise the customer that engineering is investigating the concern.

This PI will be updated or a bulletin will be released once a determination has been made by engineering.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
2880758*	U3000 Sym 92 Global Reset and Clear Codes	0.4 Hr.
*This is a unique Labor Operation for Bulletin use only.		

Version	2
Modified	01/29/2026 Created on 03/26/26- Updated to revise correction

