

MAS005090 RU 26-06

**RAPID UPDATE**

FROM: Maserati TSO

TO: Maserati Network



**Maserati**

PERSONAL SERVICE LAB

MASTERS OF CARE

# Rapid Update 819 MC20 – BCM SW Update

TECHNICAL SERVICE OPERATIONS



DATE: March 24, 2026

Certain Maserati vehicles listed in MODISCS+ are involved in a Rapid Update to update the Body Control Module (BCM) Software.

**VEHICLES INVOLVED:** MC20 (M240), Model Years 2023–2026

Some vehicles may exhibit a concern related to the **Remote Start timer**. In these cases, the Body Control Module (BCM) may not correctly align the expected timer behavior with the vehicle's actual response time. This timing mismatch can interrupt the procedure and cause the remote start function to fail. A software update is required to correct the timer settings and ensure the Remote Start procedure completes successfully.

We remind you that all the Rapid Updates must be performed within the first workshop visit, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for vehicles in Stock Dealer / PDI, it is necessary to carry out all action operations before delivery to the end customer, as required by the White Book and explicitly reported in the Pre-delivery checklist.

**Please read and review this bulletin first before ordering parts and/or starting the procedure.**

Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions.

Thank You for your continued support and cooperation.

Maserati Americas  
Aftersales Dept.

# Technical Procedure

Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.

## Prerequisites Before Beginning the Software Update

Before starting the update procedure, ensure the following conditions are met:

- **Connect the E-XTEQ MAXIMUS** to maintain the required system voltage and current throughout the update. *(Required)*
- **Ignition ON, Engine OFF.**
- **Vehicle parked with the SGW unlocked.**
- **MD-Evo scan tool software version 9.8.2 or newer** must be installed.
- **Follow all on-screen prompts provided by the MD-Evo scan tool** during the procedure.

## BCM Programming

1. With the engine OFF and the battery charger connected, open MD-Evo.
2. Navigate to **BCM – ECU Programming** and perform the software update.
3. After the programming completes, run:  
**BCM → Procedures → PROXI Alignment**
4. Once complete, the vehicle may be approved.

Software version to be installed (or newer).

ECU	F188 - VM SW Number
BCM	670360982

## Warranty Claim Information

Please complete the warranty request as follows:

Description	Code
Rapid Update Number	819
Warranty code	23
Error code	063
Component Code	8.61.035
Operation Code <ul style="list-style-type: none"><li>▪ SW Update</li></ul>	8.61.035.A (0.20 h)