

Technical product information

Topic	DTC B101629 and/or B12F129 and/or B151329 evident with 0015 (Airbag) with Airbag Indicator Lamp - Illuminated
Market area	Bentley: worldwide (2WBE),China 796 VW Import Comp. Ltd (Vico), Beijing (6796)
Brand	Bentley
Transaction No.	2080902/2
Level	EH
Status	Released for publishing
Release date	March 27 2026

Event memory entries

Diagnostic address	Event memory entry	Fault type	Fault status
0015 - Airbag	B12F129: Front passenger airbag -enabled- indicator lamp implausible signal		Intermittent
0015 - Airbag	B12F129: Front passenger airbag -enabled- indicator lamp implausible signal		static
0015 - Airbag	B151329: Front passenger airbag indicator lamp, text illumination implausible signal		static
0015 - Airbag	B101629: Front passenger airbag -disabled- indicator lamp implausible signal		Intermittent
0015 - Airbag	B101629: Front passenger airbag -disabled- indicator lamp implausible signal		static
0015 - Airbag	B151329: Front passenger airbag indicator lamp, text illumination implausible signal		Intermittent

New customer code

Object of complaint	Complaint type	Position
information, navigation, communication, entertainment -> symbolic warning indicators -> airbag system warning display	functionality -> activates	

Vehicle data

Continental GT/GTC

Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
3S3*	2018	E		*	*	*
3S3*	2019	E		*	*	*
3S3*	2020	E		*	*	*
3S3*	2021	E		*	*	*
3S3*	2022	E		*	*	*
3S3*	2023	E		*	*	*
3S3*	2024	E		*	*	*
3S4*	2019	E		*	*	*
3S4*	2020	E		*	*	*
3S4*	2021	E		*	*	*
3S4*	2022	E		*	*	*
3S4*	2023	E		*	*	*
3S4*	2024	E		*	*	*

Flying Spur

Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
ZG2*	2020	E		*	*	*
ZG2*	2021	E		*	*	*
ZG2*	2022	E		*	*	*
ZG2*	2023	E		*	*	*
ZG2*	2024	E		*	*	*

Documents

Document name
master.xml

DTC B101629 and/or B12F129 and/or B151329 evident with 0015 (Airbag) with
Airbag Indicator Lamp - Illuminated

Customer statement / workshop findings

Customer Statement

The customer reports that the airbag warning lamp is illuminated in the instrument cluster and the front passenger airbag indicator lamp within the roof console does not function.



Figure 1. Airbag warning illuminated in the instrument cluster

Workshop Findings

Customer findings of airbag warning lamp illuminated in the instrument cluster verified in the workshop with the following DTCs stored in the airbag control module (address word 0015):

- B101629: Front passenger airbag - disabled- indicator lamp implausible signal – symptom code 9442857
- B12F129: Front passenger airbag -enabled- indicator lamp implausible signal – Symptom code 9629993
- B151329: Front Passenger airbag indicator lamp, text illumination implausible signal – symptom code 9769769

Technical background

An implausible signal from the passenger airbag indicator is being reported to the airbag control unit. This behaviour is consistent with a connection or fitment issue at the roof console indicator module. A connection check and module fit inspection is required. Refer to the *Measure* section for the approved service action.

Revision History

2080902/2 – Revised TPI title to reflect applicable DTC codes.

Production change

Not applicable

Measure



CAUTION

Follow all ElsaPro airbag safety procedures. Incorrect handling can cause system faults or unintended deployment. Before disconnecting any connectors, switch off the ignition and allow control units to shut down.

1. Inspect the roof console module and ensure the housing is fully clipped together.

Gaps or incomplete assembly may cause the indicator not to function.

2. Remove the front roof console module, check all electrical connectors at the roof console module.

Refer to ElsaPro → Rep. Gr. 70 'Front roof console - To remove and fit'

3. Confirm terminals are fully seated, check for bent, recessed or damaged pins

4. Disconnect and reconnect the roof console module.

5. Clear DTCs and recheck operation.

6. If the warning lamps clear and the system functions normally, no further action is required.



NOTICE

If faults persist or the indicator lamp remains inoperative, please raise a full technical DISS query and escalate it to second-level review by the Electrical TM for further guidance.



Include the following in the full technical DISS query:

- VIN, model, MY
- Customer Statement: "2080902 Support"
- Symptom description.
- Complete diagnostic logs.

Warranty accounting instructions

Warranty type 110 or 910

Damage service number 96 20

Damage code 00 40

Labour

Time to remove and fit roof module

Labour Operation Code: 96 20 19 00

Time: 20 TU (Continental GT/GTC)

Time: 10 TU (Flying Spur)

GFF Guided Functions

Labour operation code 01 50 00 00

Time 10 TU

Parts information

No parts are required for the initial repair procedure.

If further action is advised through a DISS response, part numbers and replacement guidance will be provided by Bentley Technical Support.