



SERVICE ACTION

Global Service Action
Number: D092

Subject: Incorrect Front Fender Vent Trim Panel Installed	Publication No.: D092
	Model: Range Rover Sport (L1)
	Model Year: 2026
	Date of Issue: 05 March 2026
	Expiry Date: 30 March 2028

To:	All National Sales Companies (NSCs), importers, retailers and authorized repairers.
For the Attention of:	The approved JLR retailer / authorized repairer.
Important:	<p>NOTE: The information in this campaign is intended for use by professional technicians. If you are not a JLR retailer / authorized repairer, do not assume that a condition described affects a specific vehicle. Contact an authorized JLR retailer / authorized repairer to determine if this campaign applies to a specific vehicle.</p> <p>This campaign has been issued to provide the relevant repair instructions, parts and warranty information. This campaign is valid for two years only. Repairs must be completed prior to the expiry date at the top of this campaign.</p>

FOR THE ATTENTION OF ALL:

DESCRIPTION OF ISSUE

A concern has been identified on certain 2026 model year Range Rover Sport Autobiography wrapped vehicles, where the incorrect front fender vent trim panel has been installed. Vehicles in this condition do not meet the JLR intended build specification.

ACTION TO BE TAKEN

At the next opportunity, you are requested to repair the vehicle.

Check the JLR Warranty Portal to make sure affected vehicles are correctly identified prior to starting this campaign. The Warranty Portal will be updated to reflect only those vehicles affected.

JLR retailers / authorized repairers are reminded that they must not sell vehicles identified as affected by this campaign until such time as the repair has been successfully completed.

An owner may indicate that a repair has already been completed for this concern, in which case the full cost of the repair should be reimbursed. Refer to the warranty section of this campaign for details of the Customer Reimbursement and Related Damage Process. At the time of confirming a booking for a vehicle repair, make sure you check the Warranty Portal to confirm if there are any

other outstanding campaigns, to make sure the correct parts are available and adequate workshop time is allocated for repairs to be completed in one visit.

	<p>The following applies to: [NORTH AMERICA]</p>
---	---

FOR THE ATTENTION OF NORTH AMERICAN TERRITORIES ONLY:

	<p>The following applies to: [NORTH AMERICA]</p>
---	---

Visit the British Brands Sales Suite (BBSS) website for a list of affected vehicles at your JLR retailer / authorized repairer. Unsold vehicles must be repaired prior to handover of the vehicle for retail sale.

Yours faithfully

Steve Oldham

Global Customer Care Quality Director

SERVICE INSTRUCTION - D092

Parts Information

Parts for this campaign are being distributed to market(s) as required. You must only order parts when a confirmed repair date is set.

The parts below must be ordered through JLR in the normal manner.

Description	Part Number	Qty / £ value
Right front fender vent trim panel	529123670	1
Left front fender vent trim panel	529123672	1
Isopropyl alcohol	*ZZZ999	£1

NOTE:

*An allowance equivalent to £1.00 Sterling has been allocated to locally source isopropyl alcohol.

SROs

Description	SRO	Time
Install new left and right front fender vent trim panels	05.10.10	0.1
Drive in / drive out	02.02.02	0.2

NOTE:

Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.

Warranty Information

Warranty claims must be submitted quoting program code D092 with the relevant option code from the table below. As option codes are used there is no requirement for you to enter [Service Repair Operation \(SRO\)](#)s or parts, these are included for information only.

Program	Option	Description	SRO	Time	Part Number	Quantity
D092	A	Install new left and right front fender vent trim panels	05.10.10	0.1	529123670 529123672 *ZZZ999	1 1 £1

Program	Option	Description	SRO	Time	Part Number	Quantity
D092	B	Install new left and right front fender vent trim panels Drive in / drive out	05.10.10	0.1	529123670	1
			02.02.02	0.2	529123672	1
					*ZZZ999	£1

NOTE:

The option that contains the drive in / drive out allowance may only be claimed when the vehicle has been brought back into the workshop for this action alone to be undertaken.

Warranty claims must be submitted in accordance with the current JLR Global Warranty Manual, and its amendments, unless stated otherwise in this campaign.

Customer Reimbursement and Related Damage Process**NOTE:**

If there is a requirement to claim for related / consequential damage or customer reimbursement, refer to the related instruction that can be found in TOPIX (in the Search box, search for 'Related Damage Claim' and open the related bulletin link).

Table of Contents

[REMOVAL AND INSTALLATION: SERVICE INFORMATION](#)

[REMOVAL AND INSTALLATION: SERVICE INSTRUCTION](#)


SERVICE INFORMATION**CAUTION:**

Care must be taken to avoid damage to the vehicle wrap and surrounding paintwork.

SERVICE INSTRUCTION

1. The front fender vent trim panel is installed with 5 clips and adhesive tape as shown in the illustration.

- The front fender vent trim panel extension is installed over the top of the vehicle wrap.
- The front fender vent trim panel extension is installed to the vehicle with adhesive tape.
- The vehicle wrap has a 1 mm to 3 mm clearance around the front fender vent trim panel.
- Isopropyl alcohol must be used to clean the area after the original front fender vent trim panel extension is removed, before installing the new part.

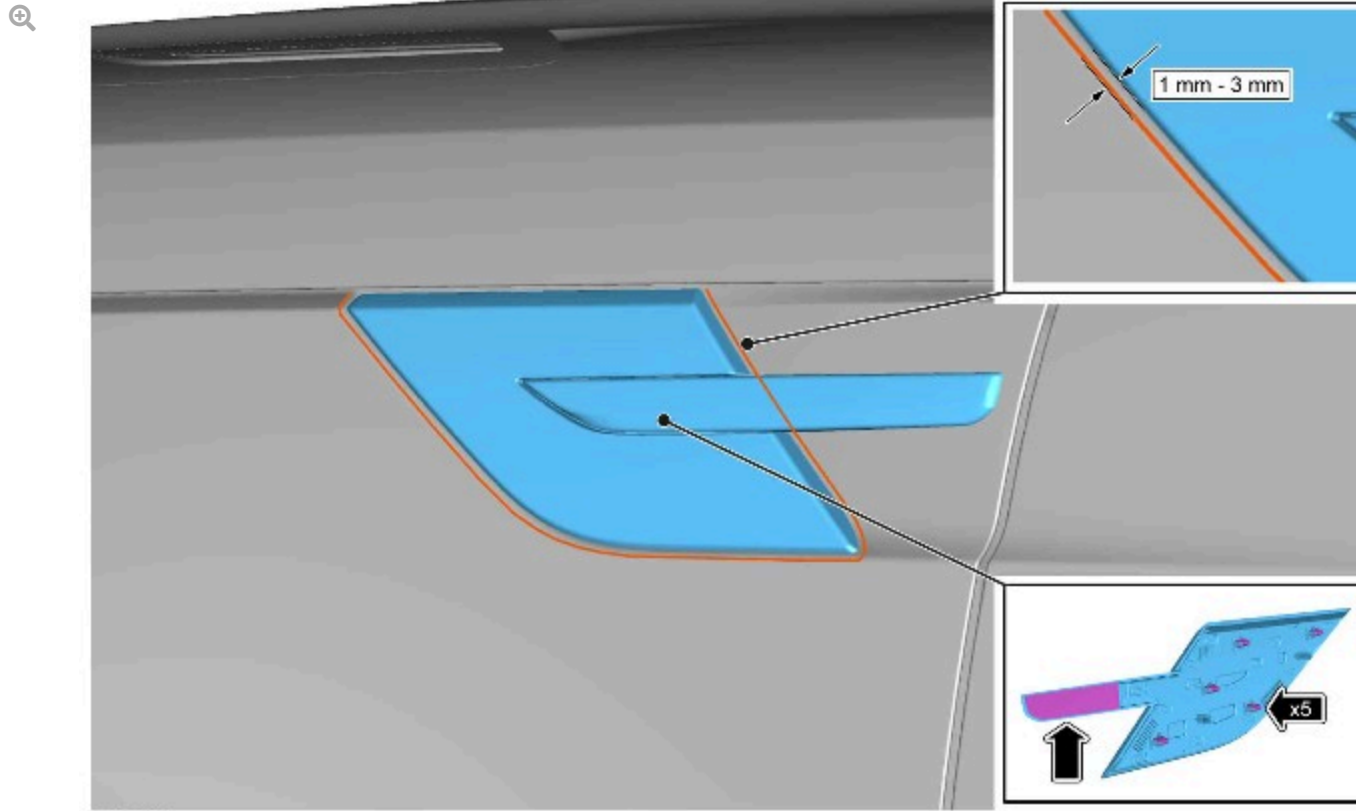

E408478

SERVICE INSTRUCTION

CAUTION:

Care must be taken to avoid damaging the vehicle wrap and surrounding paintwork.

NOTES:

- This procedure contains some variation in the illustrations depending on the vehicle specification, but the essential information is always correct.
- This procedure contains illustrations showing certain components removed to provide extra clarity.
- This procedure contains illustrations for the left side components, right side components are similar.

1. Open the hood.



2.

CAUTION:

The front fender vent trim panel extension is installed on top of the wrap, great care must be taken during removal of the front fender vent trim panel extension to avoid damaging the vehicle wrap.

Use a suitable tool to release the 5 clips and adhesive tape.

- Remove the left front fender vent trim panel.

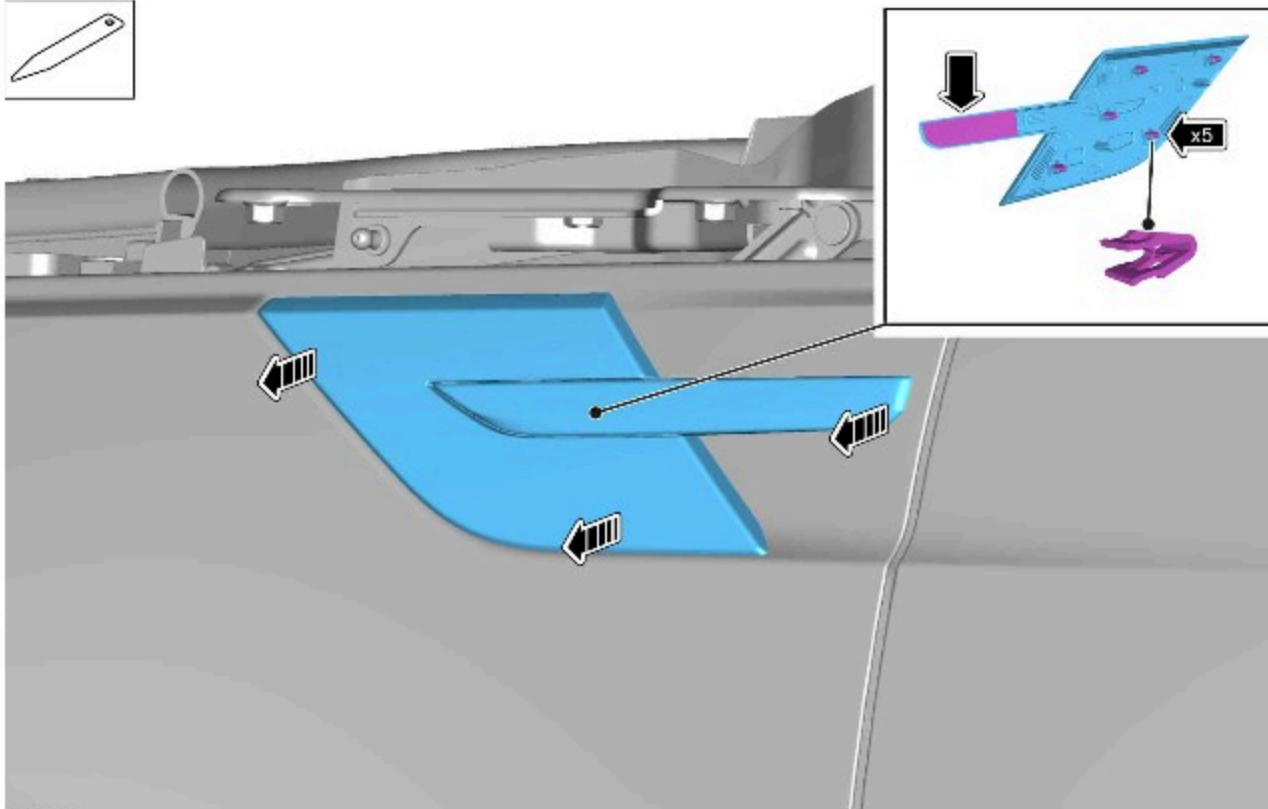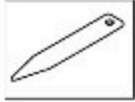


E408479

3.

CAUTIONS:

- Care must be taken to avoid damaging the vehicle wrap and surrounding paintwork.
- All isopropyl alcohol must be cleaned off of the vehicle wrap and not allowed to dry on the surface.

Clean the area using isopropyl alcohol. All adhesive tape remnants must be removed.

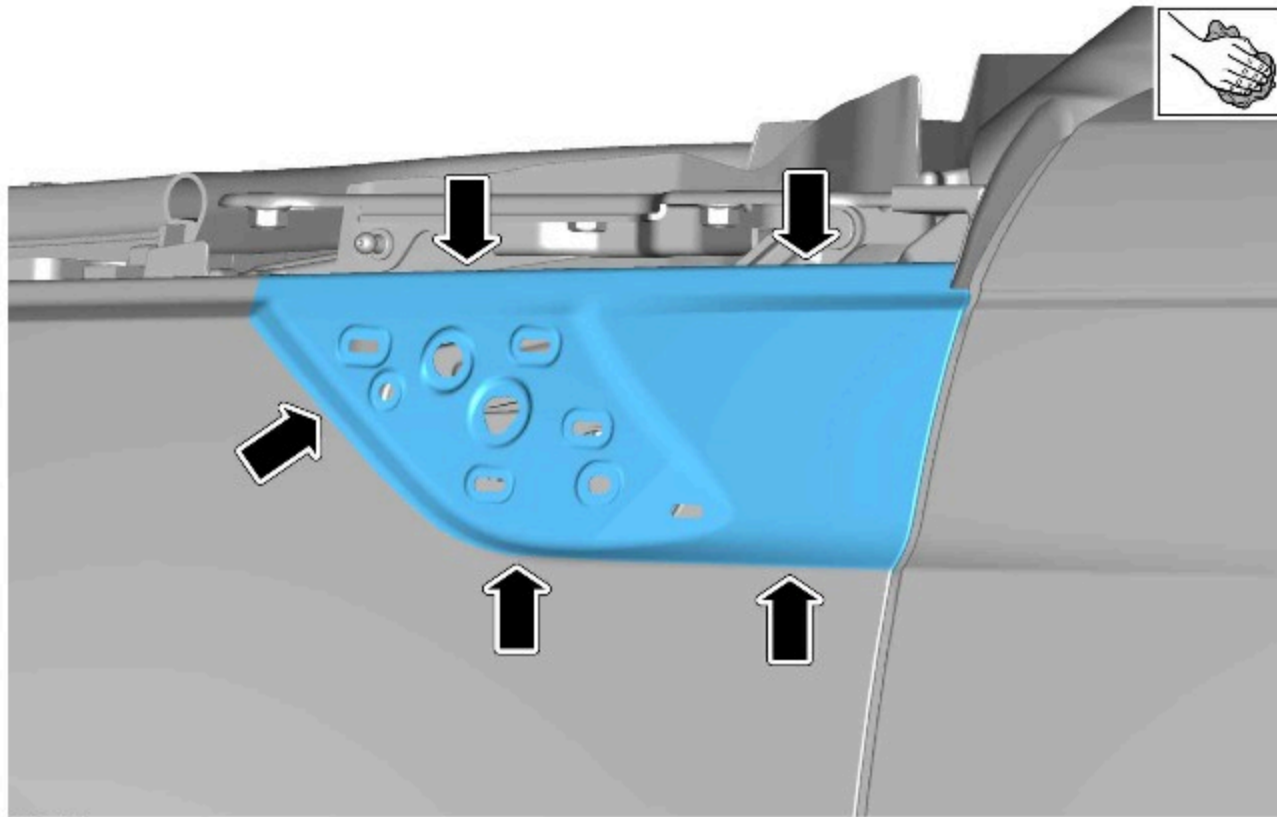

E408480


4.

CAUTION:

The front fender vent panel must be aligned as shown in the illustration.

Remove the adhesive tape backing from the left front fender vent trim panel extension.

- Align the left front fender vent trim panel clips to the fender.
- Install the left front fender vent trim panel.

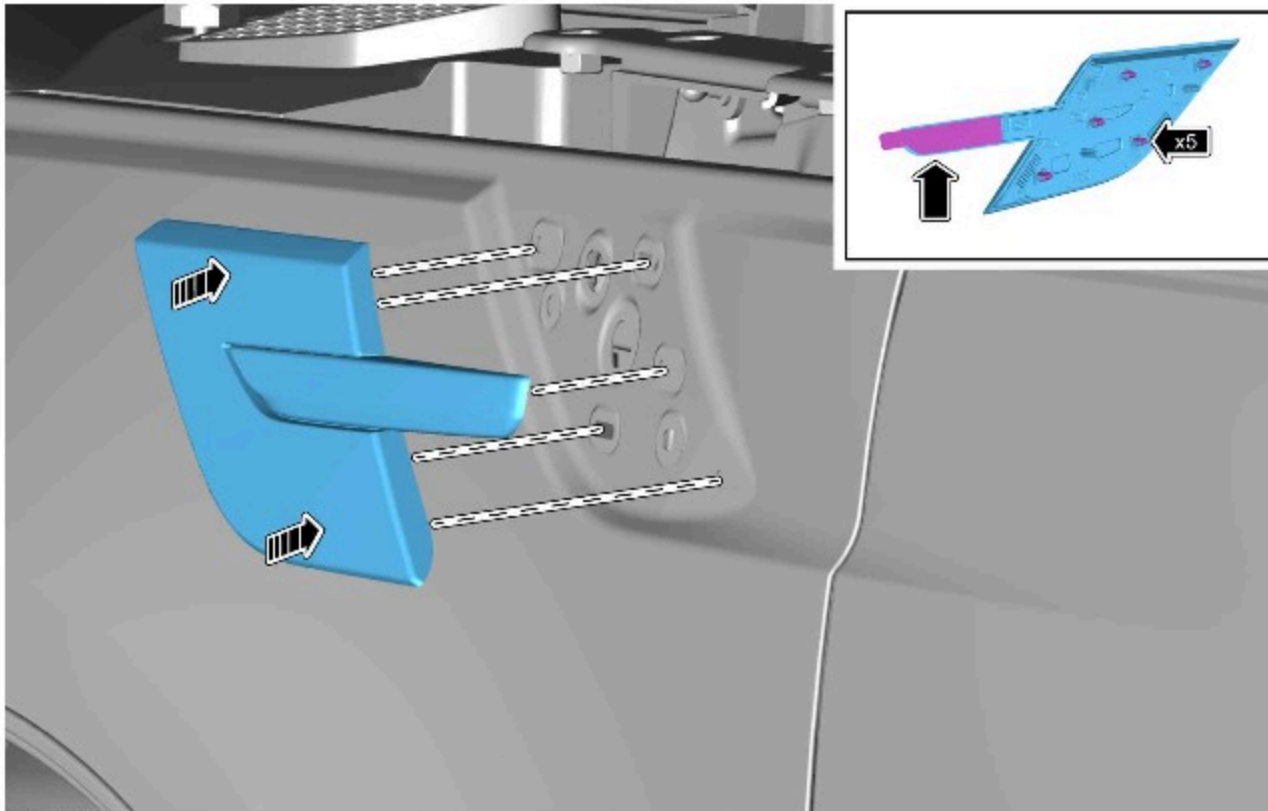

E408481

5. Repeat step 1 to step 4 for the right side.

6. Close the hood.