



SSM 54682 2026 Explorer - 2.3L - ABS/Brake System Warning With DTC C0049:01 And/Or C0049:0A Stored In The ABS Module - Built On 22-Dec-2025 And Through 02-Feb-2026

Some 2026 Explorer vehicles equipped with a 2.3L engine and built on 22-Dec-2025 and through 02-Feb-2026 may exhibit an illuminated anti-lock brake system (ABS) warning lamp or "Check Brake System" warning message with diagnostic trouble code (DTC) C0049:01 and/or C0049:0A stored in the ABS module. This may be due to a pin fit concern at connector C124 located on the brake fluid reservoir. If normal diagnostics in Workshop Manual (WSM), Section 206-09 > Pinpoint Test J verify that the loose pin fit condition is present, replace the connector using pigtail kit 3U2Z-14S411-BXAB. Refer to Wiring Diagram, Cell 05 for wiring repair information. For claiming, use causal part 14290 and labor operations 2219D and 2219D45WR.