



SSM 54692 2025-2026 Expedition - Unintended Left Turn Signal Activation

Some 2025-2026 Expedition vehicles may exhibit a left turn signal that activates after the right turn signal is activated and the steering wheel is turned to the right, then immediately back to the left (past the center position). The left turn signal will deactivate once the steering wheel returns to center. This may be due to the steering column multifunction switch. To correct this condition, replace the steering column multifunction switch (service base part number 13K359). Refer to Workshop Manual (WSM), Section 211-05. For claiming, use causal part 13K359 and service labor operations 12651D and 12651D12.