



## **SSM 54705 2021-2025 F-150 - "Active Air Dam System Fault See Manual" Warning Message In The IPC And/Or Active Air Dam (AAD) Hanging/Not Retracting**

Some 2021-2025 F-150 vehicles may exhibit an "Active Air Dam System Fault See Manual" warning message displayed in the instrument panel cluster (IPC) and/or an AAD hanging/not retracting. This may be due to a broken AAD actuator to air dam bolt or bolts. If diagnostics lead to ADD actuator as the causal part, a new lower-level service bolt and u-nut are available. It is not necessary to replace the AAD actuator if only the bolt(s) are damaged. Use part numbers W705271-S437 and W520822-S439 to resolve the concern.