

**Belt Lock Warning on Driver's Side Permanently Active in Conjunction with Fault Memory Entry with Regard to Belt Lock Switch "B101C07" (SY 10/26)**

Model Line: **911 (992)**  
**Taycan (Y1A / Y1B / Y1C)**  
**Panamera (971 / YAA / YAB)**  
**Macan (XAB)**  
**Cayenne (9YA / 9YB)**

Model Year: **As of 2017**

Concerns: **Front belt buckle, driver's side**

Cause: **The customer complains that the belt buckle warning for the driver's side is permanently active.**  
 The following fault memory entry is stored in the airbag control unit:

- **B101C07** - Front belt buckle switch on driver's side (E745), mechanical fault (901C07)

Cause: The stored fault code indicates that the seat belt on the driver's side or a "**belt buckle dummy**" remains permanently inserted in the vehicle.  
 The "**Guided troubleshooting**" already refers to incorrect handling of the belt buckle.



**Information**

Incorrect handling of the front belt buckle on the driver's side can also have an effect on other systems. Incorrect handling of the belt buckle **must** therefore be ruled out before continuing fault finding.

- Action:
- Inform the customer that it is **absolutely** necessary to fasten the seat belt after parking the vehicle and that no "belt buckle dummy" is to be used
  - Delete the fault memory of the airbag control unit (This resets the "counter" for driving without the seat belt being fastened and deactivates the permanent belt buckle warning)
  - Carry out function test of the front belt buckle on the driver's side (check switch position belted in and not belted in)



**Information**

If the function of the front driver's side belt buckle has been ensured, replacing it is not expedient for the specified complaint because this is not a defect in the belt buckle.

**Labor position and PCSS encryption****Information**

**Please note that an invoice for the action described in this Technical Information cannot be made through the new car warranty or PAW (Porsche Approved Warranty), since this is not invoice-relevant damage or a defective component.**

Labor position:

APOS	Labor operation	I No.
69240140	Delete airbag control unit fault memory and check front belt buckle on driver's side	

PCSS encryption:

<b>Location (FES5)</b>	69240	Front belt buckle
<b>Damage type (SA4)</b>	4045	warning activated

**Important Notice:** Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2026 Porsche Cars North America, Inc.