

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
Q4	2024 – 2025	All	1N7

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised header (Add Software Level) Revised <i>Service</i> (Updated Information) Revised <i>Warranty</i> (Updated Information)
1	05/22/2025	Initial publication

Customer states:

When maneuvering/parking, a creaking/rattling noise can be heard and felt through the steering wheel. This complaint occurs in comfort mode (drive select).

Workshop findings:

The complaint disappears/changes when switching from comfort mode to dynamic mode, thereby changing the steering map.

Technical Background

Optimization of steering map.

Production Solution

Optimized steering map in series production from SW4307 and target data container index "AD".

Service

Please check whether PR no. 1N7 is installed on the vehicle.

If a steering system (DA 0044) with **software version 4307** is already fitted on the vehicle, use SVM code **44A042** to flash the optimized steering map.

If a steering system (DA 0044) with **software version 4305** is fitted on the vehicle, replace the steering rack according to ETKA.

Warranty

Claim Type:	<ul style="list-style-type: none">If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.
Service Number:	4835

Damage Code:	0039		
Labor Operations:	Software version 4307		
	Software Update	0151 0010	See SRT with associated operations
	Software update	0151 0060	Time stated on the diagnostic protocol
	Software version 4305		
	Steering rack replaced	4835 55xx	See SRT with associated operations
	GFF/Guided Functions	0150 0060	Time stated on the diagnostic protocol
Claim Comment:	As per TSB 2078055/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Please note the information on predecessors and items that are included and excluded in the repair operations, as well as any associated tasks.

Additional Information

All part and service references provided in this TSB (**2078055**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2026 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.