

**Volvo Car USA LLC**
**Technical Journal**

Technical Journal Title <b>Lidar Cover Panel, Drone Noise When Driving</b>		Ref. No. <b>TJ 37321.1.0</b>	
Issuer (Dept.) <b>Technical Service</b>		Issue Date <b>2/12/26</b>	Status Date <b>2/19/26</b>
Car Market <b>United States and Canada</b>	Partner <b>3 US 7510 Volvo Car USA</b>	Function Group <b>8373</b>	
Function Description <b>Generated in Batch</b>		Page <b>Page 1 of 3</b>	

**Attachment**

File Name	File Size
TJ_37321_1.pdf	0.2312 MB
<a href="#">TJ_37321_1.m4a</a>	1.0001 MB

**DESCRIPTION:**

If the vehicle has a symptom of a drone noise according to attached sound file "TJ\_37321\_1.m4a" when driving, follow advice under "Service".

**CSC** Customer Symptom Codes

Code	Description
ZC	Body frame/Other wind noise (turbulence)

**DTC** Diagnostic Trouble Codes

**Vehicle Type**

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
356							2025-2026		-	202417-202548

**SERVICE:**

To prevent the noise from occurring, apply a foam piece with part number 32459450 on left and right side of the lidar cover panel according to attachment "TJ pdf". If there are already foam pieces mounted, please remove them and apply new ones to quality assure the foam application.

1. Place the foam piece in the channel between the lidar cover panel and the roof side, at the rear part of the lidar cover panel.
2. Press the foam downwards to the bottom of the channel.

## Technical Journal 37321.1.0

---

3. With the tool, press the foam piece towards the lidar cover panel so that the foam is placed underneath the lidar cover panel according to the picture in the attachment "TJ\_37321\_1.pdf", where below parts are shown:

A = Rail  
B = Lidar cover panel  
C = Lidar cover panel carrier  
D = Foam

### Warranty claim info:

To get a warranty claim accepted for a job described in this TJ, use the corresponding VST OP number stated in this TJ.

Please note that fault tracing is not eligible for separate reimbursement under this TJ. Any fault tracing VST operation numbers will be rejected. Note that the TJ number must be stated in the repair order text.

### VST Operation Number

VST Operation Number	Description
98801-2	Reimbursement acc. to TJ

### VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support Not Needed", use function group 8373.

**To view TJ attachments continue to next page. This TJ has one attachment and one video file.**

## TJ 37321

