



TECHNICAL SERVICE BULLETIN

Various Electrical Symptoms And/Or No Crank/No Start - Related To An Intermittent 12V Battery Drain

26-2170

15 April 2026

Model:

Ford 2025 Maverick	Built on or before 9-Oct-2025
-----------------------	-------------------------------

Markets: North American markets only

Issue: Some of the vehicles listed in the Model statement above may exhibit various electrical symptoms and/or a no crank/no start condition related to an intermittent 12v battery drain. This may be due to the software in the IPC and/or ACCM.

Action: For vehicles that meet all of the criteria in the Issue and Model statements, follow the Service Procedure to update the software in the IPC and/or the ACCM.

Warranty Status: Warranty coverage limits and policies are not altered by a TSB. Warranty coverage limits are determined by the identified causal part.

Labor Times

Description	Operation No.	Time
2025 Maverick HEV: Check For IPC Software Update Not Available, Download And Run The ACCM Software Update	262170A	0.3 Hrs
2025 Maverick HEV: Check For IPC Software Update Available Download And Run Software Updates For IPC And ACCM	262170B	0.9 Hrs
2025 Maverick 2.0L EcoBoost: Check For IPC Software Update Download And Run Software Update For IPC	262170C	0.8 Hrs

Repair/Claim Coding

Causal Part:	10849
Condition Code:	04

Service Procedure

1. Is there a software update available for the IPC?

NOTE: IPC programming can take up to 1.5 hours to complete however, no technician interaction is needed once the programming begins.

(1). Yes - download and run the " IPC - Instrumental Panel Cluster (IPC) Software Update" application in the FDRS scan tool. Proceed to Step 2.

(2). No - proceed to Step 2 as the latest software level is already installed.

2. Is the vehicle a HEV built on or before 17-Feb-2025?

(1). Yes - proceed to Step 3.

(2). No - repair is complete if a software update was performed on the IPC. If the IPC had no software update available, this article does not apply. Refer to any other applicable GSB and service messages as the WSM, Section 414-01 > General Procedures > Battery Drain Check for normal diagnostics. Repair as necessary outside of this article.

3. Is there a software update available for the ACCM?

(1). Yes - download and run the "ACCM - Air Conditioning Control Module (ACCM) Software Update" application in the FDRS scan tool.

(2). No - repair is complete, the ACCM is at the latest software level available.

© 2026 Ford Motor Company

All rights reserved.

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.