

Technical Service Bulletin (TSB)
Body Control Module (BCM) Upcoming Software Update

REFERENCE:	TSB: 08-175-26 GROUP: 08 - Electrical	Date:	April 23, 2026	REVISION:	—
VEHICLES AFFECTED:	2026 (LB) Dodge Charger			MARKET APPLICABILITY: <input checked="" type="checkbox"/> NA <input type="checkbox"/> MEA <input type="checkbox"/> SA <input type="checkbox"/> IAP <input type="checkbox"/> EE <input type="checkbox"/> CH NOTE: This bulletin applies to the North America markets.	
CUSTOMER SYMPTOM:	Technicians may find that the following Diagnostic Trouble Code (DTC) has been set: <ul style="list-style-type: none"> U113E-00 - Lost Communication With Intelligent Battery Sensor "A". (Active status) 				
CAUSE:	BCM software				

DISCUSSION:

This Information Only bulletin provides information if DTC U113E-00 is set active. If only the BCM is actively setting the U113E-00 DTC, **do not replace the Intelligent Battery Sensor (IBS)**. A hard reset with the wiTECH needs to be performed to allow the DTC to go to stored.

NOTE: An upcoming software update will be available in the 2nd quarter of 2026 for this concern.

POLICY:

Information Only.