



Service Bulletin

Bulletin No.: PIP6029A

Date: April, 2026

PRELIMINARY INFORMATION

Subject: Diagnostic Aid: Rattle or Tapping Noise Heard Near the Dashboard or a Vibration From the Shifter

| Brand: | Model: | Model Year: | | VIN: | | Engine: | Transmission: |
|-----------|-------------|-------------|----|------|-----|---------|---------------|
| | | from | to | from | to | | |
| Buick | Encore GX | 2020 - 2023 | | All | All | All | M3F, MRG |
| Chevrolet | Trailblazer | 2021 - 2023 | | All | All | All | M3F, MRG |

| | |
|-----------------------------------|--|
| Involved Region or Country | North America |
| Condition | Rattle or Tapping noise heard near the dash or a vibration in the shifter. |
| Cause | Possible shifter cable sleeve contact or cable routing concern. |

Correction

Some Customers may have an issue with a rattle or buzz noise coming from the dashboard or center console area.

This may also present as a vibration in the shifter assembly.

If the noise has been confirmed, inspect the shifter cable for possible contact.

If this is found insulate the crimped metal sleeve on the shifter cable as pictured below.



6783157

Note: Do not secure the shift cable tightly to the body with a zip tie or any other method. Due to engine movement the cable must be allowed to move freely.

Note: Do not add foam tape to the large round dampening weight on the cable as this could make the concern more noticeable.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

| Labor Operation | Description | Labor Time |
|--|--|------------|
| 8486468* | Apply Foam to Shifter Cable for Rattle Noise | 0.3 Hr. |
| *This is a unique Labor Operation for Bulletin use only. | | |

| | |
|----------|--|
| Version | 2 |
| Modified | 12/10/2024 - Created on 04/21/2026 - Updated to correct labor operation |

