

Preview Solution CBR-2562-15

Electric Pneumatic Module (EPM) Fault Code C10C256 - AN (4) - PR - VN (4)

Published 17 April 2026

Valid For

Volvo Chassis - VN (4)

Mack Chassis - AN (4), PR


Model Year - 2024 to current

The purpose of this CBR is to provide troubleshooting support for fault code C10C256.

Overview

When fault code C10C256 is active please inspect X3 on the Electronic Pneumatic Module (EPM) for corrosion. (see pictures below.)

X3 location

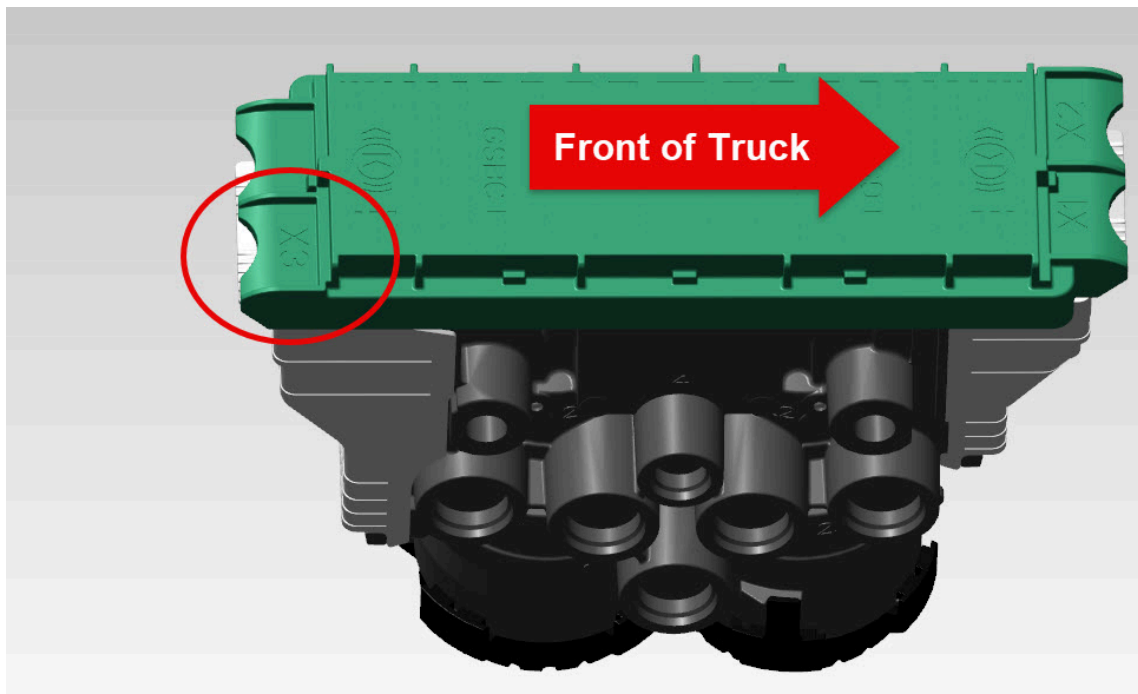

Corrosion present in connector.

**No Corrosion Found:**

Please order cover part number: **995115**. Install cover on X3 port and clear faults. If faults return please follow PTT

Corrosion Found:

Please order a new EPM and cover part number **995115**. Replace the EPM with the new part and install cover on new EPM X3 port.

NOTE: DO NOT USE DIELECTRIC GREASE BEFORE CAPPING X3.

Related links and attachments

No links or attachments available



Share

to others that might find it helpful



Feedback

[Give feedback](#)

to help improve the content of this article