

 Preview Solution CBR-2573-1

Mack Chassis - Through Shaft Bearing Retainer Breakage On Mack Carriers

Published 8 April 2026

Valid For


Mack Chassis - All models with Mack carriers

Model Year - All years with Mack carriers

Mack Carrier through shaft bearing retainer plates failing in the aftermarket after a field repair.

Fault tracing

Be sure to check that there are no binding issues with the interaxle drive shaft and u-joints and that the suspension attachment points to the axle and the transverse torque rod mounting on the carrier are not damaged or loose. Correct all as needed. Replace the damaged through shaft retainer plate and use only the thicker shim gasket. **PN 25102061.**

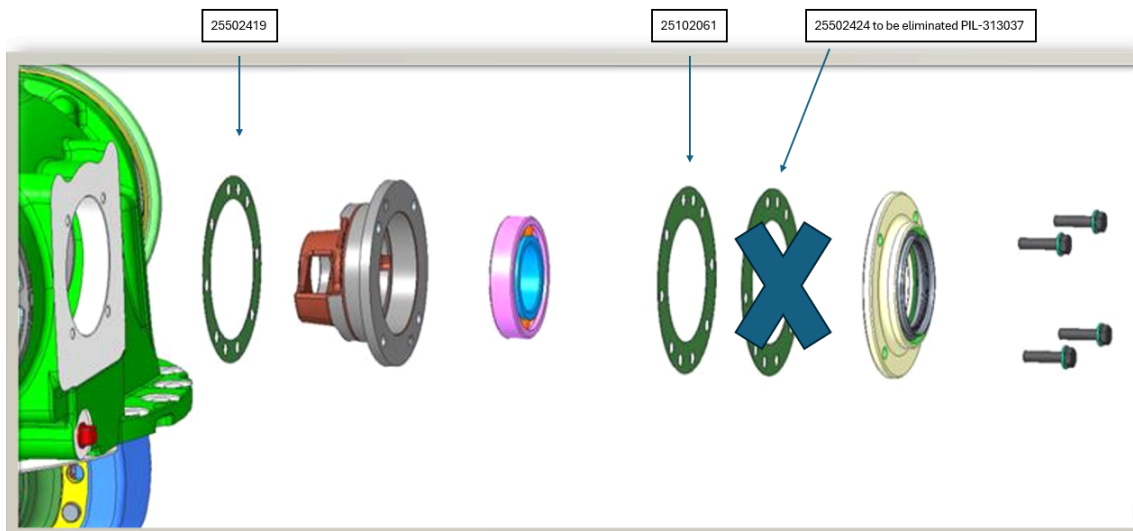

Related links and attachments

No links or attachments available



Share

to others that might find it helpful



Feedback

[Give feedback](#)

 Live UI

to help improve the content of this article