

 Preview Solution CBR-2575-1

Mack Chassis - Dash Panel Cracking at Mounting to BIW

Published 29 April 2026

Valid For

Mack Chassis - Anthem, Pinnacle's, Granite's
Model Year 2018 to 2025

Certain Mack chassis vehicles could experience dash cracking at the mounting points to the Body-In-White.





To alleviate this issue, replace the current dash mounting screw (PN: 25099161) and washer (PN: 25100378) with the new screws with an inbuilt rubber washer (PN:78630681) at the 5 mounting locations around the instrument panel. Replace the dash mounting screw (PN: 25089319) and washer (PN:25100378) with new screw with washer (PN: 994793) at 2 locations of the passenger panel.

New Part Number	Quantity
78630681 - Screw with washer	5
994793 - Screw with washer	2

Related links and attachments

No links or attachments available

 Live UI



Share

to others that might find it helpful



Feedback

[Give feedback](#)

to help improve the content of this article