



Connection offline

Technical Service Bulletin

Transaction No.: **2062601/2**

90 Workshop info: DAS control unit, entry "U110100: Component protection active (symptom number 15361024)" - FAZ9488E

Release date: Apr 23, 2026

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
e-tron	2019	All	00A5 – Front sensor for driver assistance systems With software version: 0365 0367
A6, A7, A8, and Q8	2019 – 2020		
A6 allroad, S6, S7, A8 e quattro, S8, e-tron Sportback, Q7, SQ7, SQ8, and RS Q8	2020		

REVISION HISTORY

Revision	Date	Purpose
2	-	Revised <i>Service</i> (Modified verbiage)
1	03/08/2021	Initial publication

Workshop findings:

The following **active/static** event memory entry is logged in the driver assist systems control unit -J1121- (diagnostic address 00A5):

- U110100: Component protection active (**symptom number 15361024**)

The event memory entry only occurs if the software for the driver assist systems control unit (diagnostic address 00A5) has been updated to **SW0365** beforehand.

The following message appears in ODIS if an attempt is made to deactivate component protection using Guided Functions:

- FAZ9488E**



This TSB is only relevant if the event memory entry specified above is present with the exact associated symptom number and it occurred when the software for the driver assist systems control unit -J1121- (diagnostic address 00A5) was updated to **SW0365**.

Technical Background

Diagnosis issue in driver assist systems control unit -J1121- (diagnostic address 00A5).

Production Solution

Not applicable.

Service

The event memory entry does **not** lead to a restricted function or a message in the instrument cluster. Further measures are not required.

Replacing the driver assist systems control unit -J1121- will not solve the problem, even if this is recommended by Guided Fault Finding.

If parts are changed or replaced under warranty without good reason, the costs will be charged back.

Warranty

This TSB is informational only and not applicable to any Audi Warranty.

Additional Information

All part and service references provided in this TSB (**2062601**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2026 Audi of America, LLC / Audi Canada, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.