

## Condition

| Model(s)                                      | Year(s) | VIN Range | Vehicle Specific Equipment  |
|---|---------|-----------|---|
| Q5, Q5 Sportback, SQ5, and SQ5 Sportback (GU) | 2025    | All       | Front sensor for driver assistance systems<br>– 00A5<br>Software:<br>0250<br>0295 |

| REVISION HISTORY |            |   |
|------------------|------------|---|
| Revision         | Date       | Purpose   |
| 6                | -          | Revised header (updated module SW filter)   |
| 5                | 02/19/2026 | Revised <i>Warranty</i> (Update warranty table)                                       |
| 4                | 12/13/2025 | Revised header (Corrected models)<br>Revised <i>Condition</i> (Corrected model table) |

### Customer states:

The yellow warning message "**Left/right main beam headlight defective. See owner's manual**" appears in the instrument cluster while driving.

There are no functional restrictions in the main beam headlights.

The warning lamp disappears after switching the ignition off and then on again but subsequently appears intermittently.

### Workshop findings:

The complaint can be reproduced.

DTC **C12FC01 LED channel 4, electrical fault, symptom 139272** is stored in diagnostic address 0029 (Left light control) and/or 0039 (Right light control).

There are no functional restrictions in the main beams/additional main beams.

## Technical Background

Software issue.

## Production Solution

Optimized target data container (TDC) for diagnostic addresses 0029 and 0039 from week 26/2025 onwards.

0029 – 8MA.909.519.E - 0001

0029 – 8MA.909.520.E - 0001

## Service

This TSB replaces PSS 2078182, *94 Warning lamp in instrument cluster: "Left/right main beam headlight defective. See owner's manual" DTC C12FC01.*

Please perform TSB 2079690, *00 Combined software update 03.10.00/C (28.13.01) KD2 for this concern.*

## Warranty

|                          |   |           |                                    |
|--------------------------|---|-----------|------------------------------------|
| <b>Claim Type:</b>       | • If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.   |           |                                    |
| <b>Service Number:</b>   | 9407  |           |                                    |
| <b>Damage Code:</b>      | KD02  |           |                                    |
| <b>Labor Operations:</b> | Software update, including connecting battery charger   | 0151 0010 | See SRT with associated operations |
|                          | Fixed rate for software update, including all required preliminary and follow-up work (including bus sleep cycle, calibration drive, additional work and restarting software update if flashing is aborted) | 0151 0040 | 130 TU                             |
|                          | An additional flat-rate of 50 TU is possible for each flash process that is aborted.  | 0150 9999 | 50 TU                              |
| <b>Claim Comment:</b>    | As per TSB 2078609/6  |           |                                    |

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

When carrying out this TSB, time stamps are not required for billing under warranty. You are therefore permitted to work on other vehicles at the same time. The update can also be performed by non-productive personnel.

## Additional Information

All part and service references provided in this TSB (**2078609**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2026 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.