

## Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
Q6 Sportback e-tron, and SQ6 Sportback e-tron	2025	All	Not applicable
	2027	000000 – 000881	

### REVISION HISTORY

Revision	Date	Purpose
2	-	Revised header (Adjusted for visibility)
1	04/09/2026	Initial publication

### Customer states:

The customer's vehicle has one of the following issues:

- Rattling noises coming from rear of vehicle (in vicinity of GPS antennae).
- Restricted GPS signal.
- Restricted radio signal.

### Workshop findings:

The customer complaint can be reproduced.

## Technical Background

In unfavorable circumstances, the expanding nut for the earth cable to the GPS aerial may not form a proper connection between the metal cross member of the D-pillar and the earth cable. This leads to rattling noises, or a restricted GPS signal or radio signal.

## Production Solution

Vehicles produced from 02/26/2026 onwards are fitted with an optimized expanding nut (part number WHT.000.748).

## Service

To clearly assign the complaint to this TSB, check earth point 654 with a borescope. The area is accessed via the opening on the right side of the luggage compartment between the roof trim and the body (see Figure 1).



**Figure 1.** Earth point 654

This complaint applies if the two clips of the expanding nut are not securely in contact with the body.

In this case, please replace the expanding nut. The part number of the required expanding nut is **WHT.000.748**.

If the expanding nut makes secure contact, please perform Guided Fault Finding using the ODIS-S tester.

## Warranty

<b>Claim Type:</b>	<ul style="list-style-type: none"> <li>If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.</li> </ul>		
<b>Service Number:</b>	9113		
<b>Damage Code:</b>	0012		
<b>Labor Operations:</b>	Check earth point	9798 0199	20 TU
	<b>Below only if nut is found loose</b>		
	Loosen and secure roof trim	7084 0910	See SRT with associated operations
	Repair earth point	9798 4199	10 TU
<b>Claim Comment:</b>	As per TSB 2081609/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Please note the information on predecessors and items that are included and excluded in the repair operations as well as any associated tasks.

## Required Parts and Tools

Part Number	Part Description	Quantity
WHT000478	Expanding nut	01

## Additional Information

All parts and service references provided in this TSB (**2081609**) are subject to change and/or removal.

©2026 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.