

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
Q5, Q5 Sportback, SQ5, and SQ5 Sportback	2025 – 2026	All	Not applicable

Customer states:

The customer complains about a **fault message regarding the front turn signal** (left or right).

The **turn signal display** in the instrument cluster **flashes at a higher frequency**. The headlight's cornering light function works.

Workshop findings:

The complaint can be reproduced in the workshop.

The following event memory entry is logged in diagnostic address 0029 (left light control unit) and/or diagnostic address 0039 (right light control unit):

- **C13D301** – LED channel 1, master: electrical fault, symptom number 139264.

Technical Background

Incorrect LED basic setting during headlight manufacturing process. In isolated cases, this can result in incorrect activation of the turn signal LED channel.

Production Solution

Optimized LED basic setting process implemented in production on 1 September 2025.

Service

If the customer complaint can be reproduced **and entry C13D301 with symptom number 139264** is logged in the event memory of the control unit with **diagnostic address 0029 or diagnostic address 0039**, the following measure is required:

The **“Perform initial operation”** functional check for the headlights must be performed in GFF for **both** light control units (diagnostic addresses 0029 and 0039).



The functional check can be found in GFF under the corresponding control unit addresses.

The initial operation must be performed for **both** control units, regardless of which of them caused the complaint.

It is not necessary to replace the headlights or the output module!

Warranty

Claim Type:	<ul style="list-style-type: none"> If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only. 		
Service Number:	9402		
Damage Code:	0011		
Labor Operations:	GFF / Guided Functions	0150 0010	See SRT with associated operations
	GFF / Guided Functions	0150 0060	Time stated on the diagnostic protocol
Claim Comment:	As per TSB 2081610/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Please note the information on predecessors and items that are included and excluded in the repair operations as well as any associated tasks.

Additional Information

All part and service references provided in this TSB (**2081610**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2026 Audi of America, LLC / Audi Canada Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.