

 Connection offline

## Technical Service Bulletin

45 ABS/ESP intervenes early at low speeds

Transaction No.: **2081760/1**

Release date: Apr 22, 2026

### Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
A3, S3, and RS 3	2025	All	With PR Code 1X0 With software version 0379

#### Customer states:

- ABS/ESP intervenes very early when cornering and at low speeds (e.g. when exiting a roundabout).

#### Workshop findings:

- The complaint can be reproduced.

#### and

- The cause can be clearly assigned to the ABS/ESP system.

#### and

- The software version in the ABS/ESP control unit is 0379.

### Technical Background

Software issue in ABS/ESP control unit

### Production Solution

From week 48/2024 with ABS/ESP software version 331

### Service

If you can clearly reproduce the issue and assign it to the ABS/ESP control unit, update the software to version 0337 using SVM codes 03A041 and 03B041. Please run the codes one after the other, ensuring that the prerequisites are complied with (e.g. the parking brake must be released). Once you have run the codes successfully, please perform basic setting of the parking brake.

**Note:** DTC **U045200** with symptom 17257 can be ignored if it is logged. This entry does not lead to a customer complaint and can therefore be disregarded. Corresponding permission to ignore this entry is stored in ODIS.

### Warranty

<b>Claim Type:</b>	<ul style="list-style-type: none"><li>• If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.</li></ul>
<b>Service Number:</b>	4545

<b>Damage Code:</b>	0039		
<b>Labor Operations:</b>	Software update	0151 0010	See SRT with associated operations
	Software update	0151 0060	Time stated on the diagnostic protocol
<b>Claim Comment:</b>	As per TSB 2081760/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Please note the information on predecessors and items that are included and excluded in the repair operations, as well as any associated tasks.

Try to reproduce the customer complaint (based on the description/cause of the issue), so that it can be clearly assigned to this TSB. The following repair must only be carried out if all the criteria (model/type, chassis number, engine/motor, gearbox code, PR number(s), part number, software version, code, etc.) apply exactly. Otherwise, this solution will not eliminate the problem and repeat repairs may be necessary. In such a case, the warranty claim may be rejected, and the cost of the parts may be charged back.

## Additional Information

All part and service references provided in this TSB (**2081760**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2026 Audi of America, LLC / Audi Canada, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.