



SSM 54785 2022-2024 Maverick - 2.5L Hybrid - Various Electrical Symptoms And/Or No Crank/No Start - Related To An Intermittent 12V Battery Drain That Has Discharged The 12V Battery

Some 2022-2024 Maverick hybrid vehicles may exhibit various electrical symptoms and/or a no crank/no start condition related to an intermittent 12V battery drain that has discharged the 12V battery. This may be due to the software in the anti-lock brake system (ABS) module. To correct this condition, download and run the "ABS - Anti-lock Brake System (ABS) Module Software Update" and "ACCM - Air Conditioning Control Module (ACCM) Software Update" applications using the latest software level of the Ford Diagnosis and Repair System (FDRS) scan tool. For claiming use causal part 2005 and labor operation 12651D along with MT2005SSM up to 0.4 hours for ABS module and ACCM programming.