



SSM 54792 2025-2026 Explorer - 2.3L EcoBoost - Illuminated MIL With DTC P0335 Stored In The PCM - Built On 16-Aug-2025 And Through 5-Mar-2026

Some 2025-2026 Explorer vehicles equipped with a 2.3L EcoBoost engine and built on 16-Aug-2025 and through 5-Mar-2026 may exhibit an illuminated malfunction indicator lamp (MIL) with diagnostic trouble code (DTC) P0335 stored in the powertrain control module (PCM). DTC P033F may also be stored in the PCM. This may be due to a pin fit concern at PCM connector C1381E pin 7. To correct this condition, install a new terminal in wiring harness connector C1381E pin 7 (GN/BN) using terminal repair kit DU2Z-14474-CA. Refer to Wiring Diagram, Cell 5 for wiring repair information. For claiming use causal part 12A581 and labor operations 12650D and 12650D45WR.