

**Information Messages Regarding Assistance System Failures, Fault Memory Entry: Implausible Chassis Number "C12B3F3" in the Assistance Systems Control Unit (ZFAS) (SY 37/26)**

Model Line: **Panamera (YAA/YAB)  
Cayenne (9YA/9YB)**

Model Year: **As of 2024**

Concerns: **Front camera**

Symptom: **The customer is complaining about white warning messages indicating the failure of various assistance systems in the instrument cluster.**

The following fault memory entry is passively stored in the fault memory of the control unit for assistance systems (ZFAS):

- **C12B3F3** – Front camera for driver assistance systems – implausible chassis number (036015)



**Information**

Component replacement will not work in the case of this fault pattern.

Remedial Action: If there is a customer complaint, recalibrate the front camera; this will overwrite the faulty vehicle identification number.

**Required tools**

- Tools:
- **P90999 - Porsche Tester 4**
  - Battery charger with a current rating of **at least 90 A** and a **current and voltage-controlled charge map** for lithium starter batteries, e.g. **VAS 5908 - battery charger 90 A**. For further information about the battery chargers to be used, see the corresponding Workshop Manual. ⇒ *Workshop Manual '270689 Charging vehicle electrical system battery'*
  - **VAS 6430/1A - Adjustment device with reflector**
  - **VAS 6430/3 - Mirrors for adjustment device**
  - **VAS 6350A - Calibration unit**
  - **VAS 6430/4 - Lane Keep Assist calibration board**

**Recalibrating front camera**



**Information**

It is **not** necessary to perform wheel alignment (basic initial measurement) as part of this Technical Information.

If wheel alignment is required, it is **not** possible to invoice this via Technical Information.

- Work Procedure: 1 Recalibrate the front camera  
For work procedure, see: ⇒ *Workshop Manual '963855A1 Replace front camera'*
- 2 Read out and delete the fault memory.
- 3 Exit the diagnostic application, switch off the ignition and disconnect **P90999 - Porsche Tester 4** from the vehicle.
- 4 Switch off and disconnect the battery charger.  
⇒ *Workshop Manual '270689 Charging vehicle electrical system battery'*

### Labor position and PCSS encryption

Labor position:

APOS	Labor operation	I No.
96382540	Calibrating front camera	

PCSS encryption:

Location (FES5)	96380	Front camera
Damage type (SA4)	1611	Not functioning

**Important Notice:** Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2026 Porsche Cars North America, Inc.