



Technical Service Bulletin

GROUP CAMPAIGN	NUMBER 26-01-040H
DATE APRIL 2026	MODEL(S) TUCSON (NX4A)

SUBJECT: CRACKED INSIDE REAR COMBINATION LAMP ASSEMBLY REPLACEMENT (LIMITED COVERAGE CAMPAIGN LA19)

* IMPORTANT

Dealers must perform this field action on all affected vehicles within 5/60,000 New Vehicle Limited Warranty (NVLW) prior to customer retail delivery and whenever an affected vehicle is in the shop for any maintenance or repair. See Warranty Information section for more details.

Access the “Vehicle Information” screen via WebDCS to verify “Warranty Start Date” and ensure the vehicle is within NVLW, observing mileage prior to any repair work.

Description: Certain Tucson (NX4A) vehicles have a crack on the left-hand side of the “inside rear combination lamp assembly” due to interference with the tailgate panel. This bulletin provides instructions to replace the “inside rear combination lamp assembly.”



Applicable Vehicles (Certain):

Model Year	Model	Production Dates
2026	Tucson (NX4A)	02/02/2026 – 02/20/2026

Circulate To: General Manager, Service Manager, Parts Manager, Warranty Manager, Service Advisors, Technicians, Body Shop Manager, Fleet Repair

SUBJECT:CRACKED INSIDE REAR COMBINATION LAMP ASSEMBLY
REPLACEMENT (LIMITED COVERAGE CAMPAIGN LA19)**Parts Information:**

Model	Part Name	Part Number	Figure	Remarks
Tucson (NX4A)	Lamp Assy-Rear Combination, Ctr	92403-CW540QQH		Bulb type only
	Fastener-Dr Trim	82315-2P000		Replace if damaged
	Fastener-Dr Trim	82315-33020		
	Clip-Back Panel Mldg Mtg	87378-A4000		

NOTE 1: Dealer will be reimbursed via sublet as noted for any clips, regardless of replacement.

Warranty Information:

Model	Op. Code	Operation	Op. Time	Causal Part	Nature Code	Cause Code
Tucson (NX4A)	60DA06R0	Inside Rear Combination Lamp Assembly Replacement	0.4 M/H	92403-CW540	A32	ZZ1

NOTE 1: Submit claim on Claim Entry Screen as “Campaign” type.

NOTE 2: 5/60,000 New Vehicle Limited Warranty (NVLW) applies to the part(s) and repair procedure(s) outlined in this TSB. Prior to beginning any repair work, ensure the part(s) associated with the repair procedure are within NVLW, observing mileage and Warranty Start Date or date of first use. If the subject part(s) are out of warranty coverage, the dealer has the option to submit a PA Request for goodwill consideration on a case-by-case basis.

NOTE 3: If any part(s) not subject to this TSB are found in need of replacement while performing the repair procedure, and the affected part(s) are still under warranty, the dealer may submit a separate claim using the same repair order. If the part(s) not subject to this TSB are out of warranty coverage, the dealer has the option to submit a PA Request for goodwill consideration on a case-by-case basis.

NOTE 4: This TSB includes repair validation photos. Op times include VIN, mileage, and repair validation photo(s) as outlined in the Digital Documentation Policy.

NOTE 5: The incident parts are subject to callback through the normal Warranty Technical Center (WTC) parts return process. **Claim is subject to debit if the part is not returned.**

NOTE 6: Op codes will reimburse \$4.00 in sublet for any damaged clips during the repair procedure.


SUBJECT:CRACKED INSIDE REAR COMBINATION LAMP ASSEMBLY
REPLACEMENT (LIMITED COVERAGE CAMPAIGN LA19)**Service Procedure:****DIGITAL DOCUMENTATION**

This TSB includes repair validation photos. Refer to the latest Warranty Digital Documentation Policy for requirements.

NOTICE

Use plastic trim tools throughout the procedure to prevent damage to the vehicle trim and finish.


1. Disconnect the negative (-) battery terminal (A).

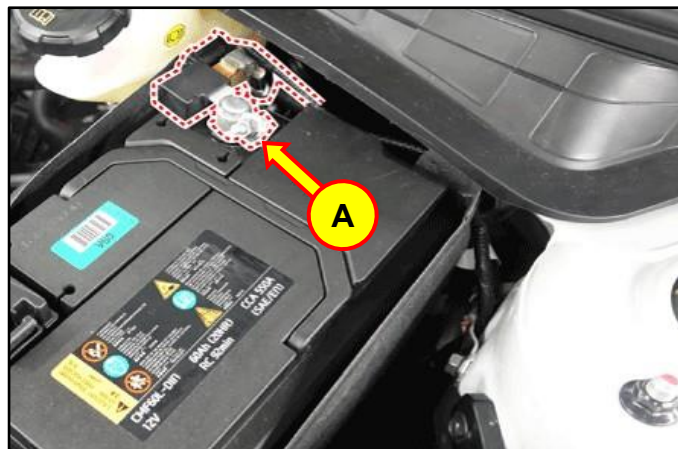

2. Remove the tailgate upper trim (B).

**Information**

Replace any damaged or broken clips (P/N: 82315-2P000).


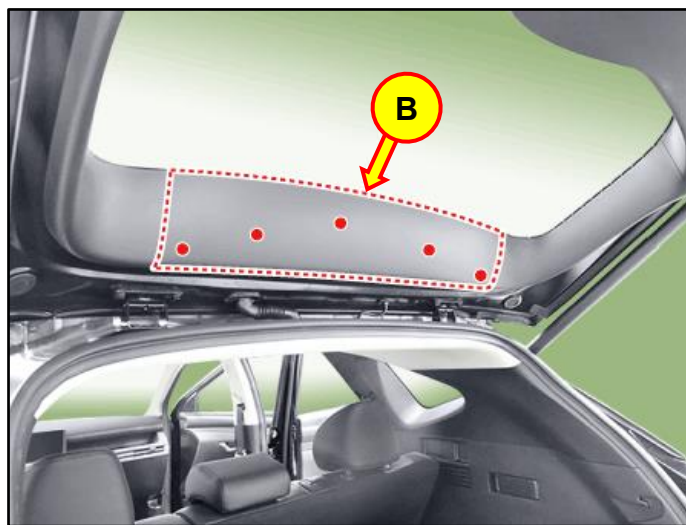


3. Remove the LH and RH tailgate side trim (C).



Information

Replace any damaged or broken clips (P/N: **82315-2P000**).

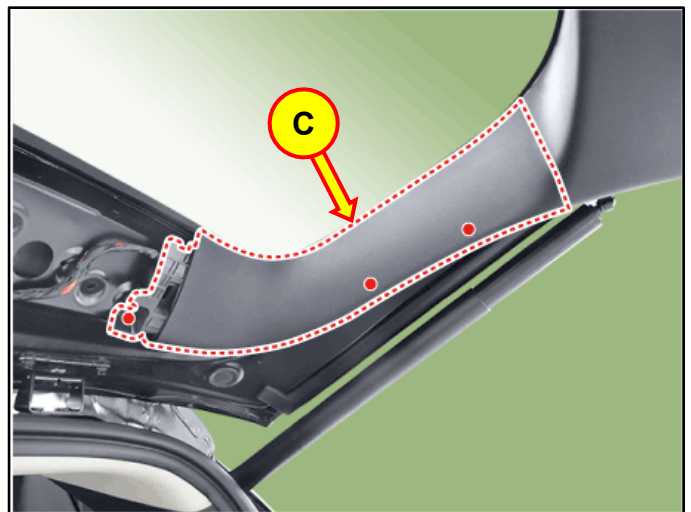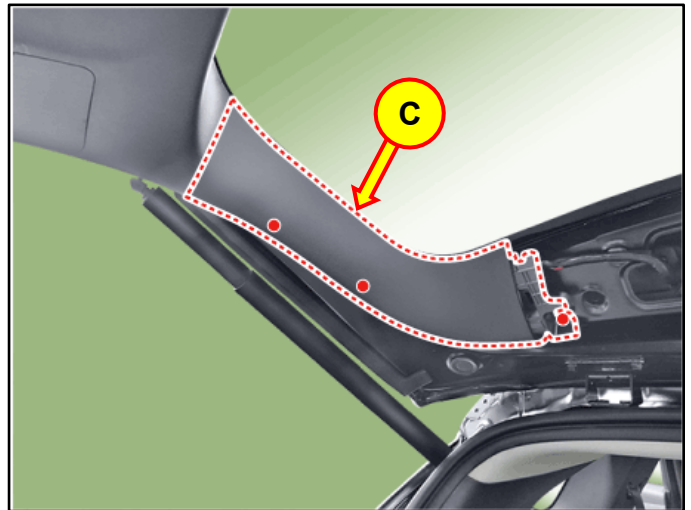


4. Remove the power tailgate inner switch (D) if equipped.



Information

Skip **steps 4 – 5** if the model trim does **NOT** apply.

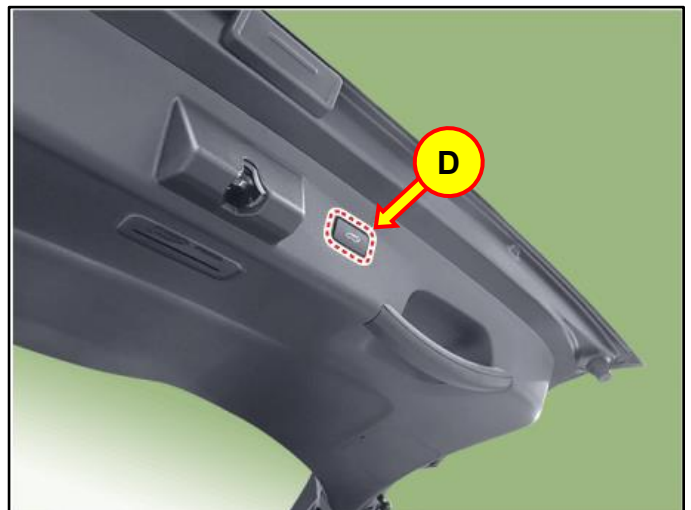


SUBJECT:**CRACKED INSIDE REAR COMBINATION LAMP ASSEMBLY
REPLACEMENT (LIMITED COVERAGE CAMPAIGN LA19)**

5. Disconnect the power tailgate inner switch connector (E) if equipped.




6. Remove the tailgate handle cover (F).

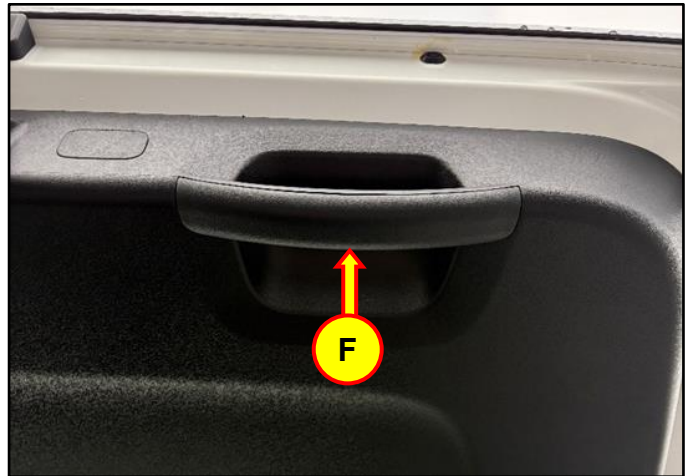

7. Remove the 4 screws then remove the tailgate lower trim (G).

***i* Information**




Replace any damaged or broken clips
(P/N: 82315-2P000 & 82315-33020).

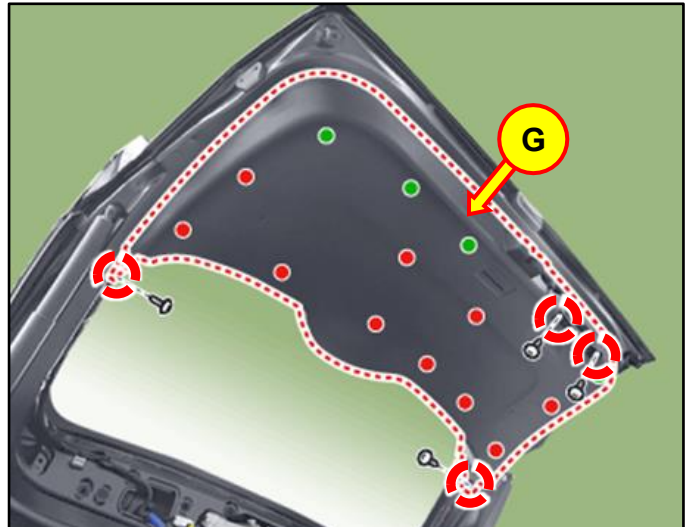

SUBJECT:

**CRACKED INSIDE REAR COMBINATION LAMP ASSEMBLY
REPLACEMENT (LIMITED COVERAGE CAMPAIGN LA19)**

8. Disconnect the **3** inside rear combination lamp connectors (H).

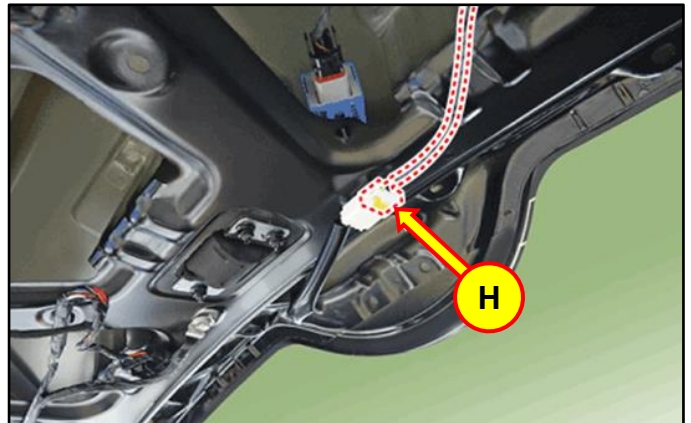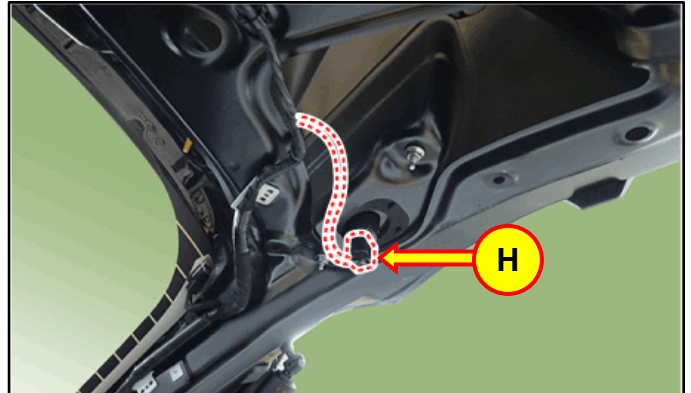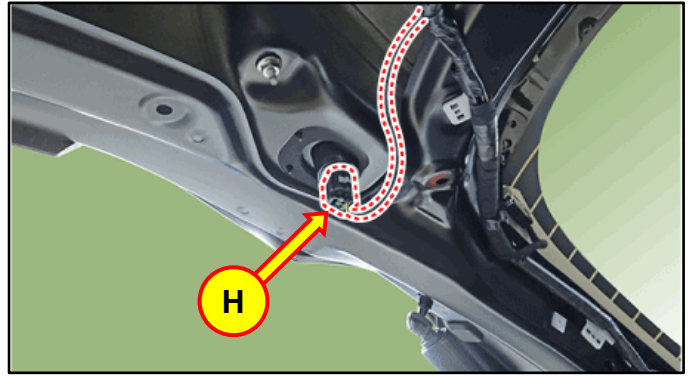

9. Disengage the **2** yellow clips from inside the tailgate then remove the tailgate upper garnish (I).

**Information**

Replace any damaged or broken clips (P/N: **87378-A4000**).

**Information**

Replace any damaged or broken clips (P/N: **82315-2P000** & **82315-33020**).




SUBJECT:**CRACKED INSIDE REAR COMBINATION LAMP ASSEMBLY
REPLACEMENT (LIMITED COVERAGE CAMPAIGN LA19)**

10. Remove the 7 nuts then remove the inside rear combination lamp assembly (J).

NOTICE

Use caution when removing the lamp to prevent damage to the vehicle.

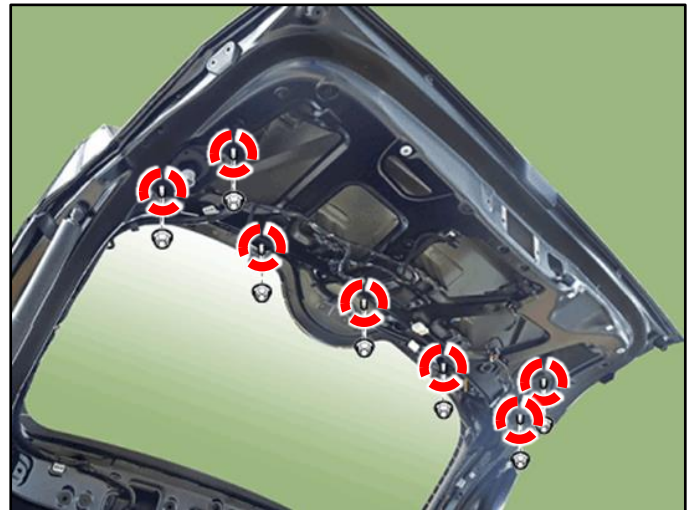

11. Install the new inside rear combination lamp assembly by first clipping it into place, then securing the 7 nuts.
12. Reinstall all parts in the reverse order of the removal process.

13.

**DIGITAL
DOCUMENTATION**

Using the STUI camera function, take a photo of the new inside rear combination lamp assembly installed on the vehicle. Focus on the area where the crack on the original part was located (LH side).

Upload the photo to STUI.

NOTE: If the STUI camera function is **NOT** used, write the last 6 digits of the VIN and date of repair on a piece of paper to include in the photo.



14. Reconnect the negative (–) battery terminal.

15. Verify proper operation of the inside rear combination lamp and power tailgate if equipped.

16. The service procedure is now complete.