



Oil Pump Housing Improvement


This instruction refers to other documents that are necessary to do the procedure.

Situation

The oil pump housing may crack.

Action

Inspect the oil pump and replace if applicable.

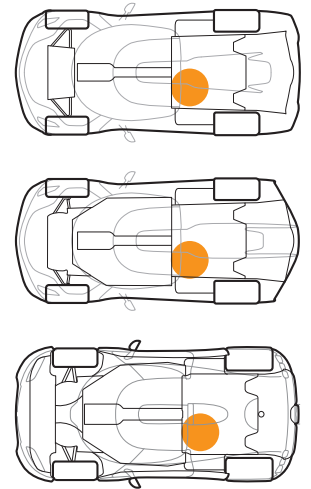

PARTS	REFERENCE	QUANTITY
Oil pump Jesko - 35mm cylindrical PRV housing	1096240	1
M8x15 -1.25 Ti flanged hex	130-149-0815	1
M8x25 -1.25 Ti bolt hex flanged	130-149-0801	3
M8x28 -1.25 bolt hex flanged	130-149-0828	3
Nord lock washer M5	130-198-5005	3
Nord lock washer M6	130-198-5006	2
O-ring 25.12x1.78 Viton	130-199-3047	4
O-ring 20.35x1,78 Viton	130-199-3049	8


TOOLS	SPECIFICATION	QUANTITY
General mechanical tools	–	–

Prepare

1. Disconnect the 12 V system, refer to:
 - Jesko, [WOM-00082](#).
 - CC850, [WOM-00489](#).
2. Lift and put the vehicle on jack stands, refer to:
 - Jesko, [WOM-00092](#).
 - CC850, [WOM-00492](#).
3. Remove the engine mudpan, refer to:
 - Jesko, [WOM-00094](#).
 - CC850, [WOM-00493](#).

Inspect the Oil Pressure Adjustment Screw Housing

1. Do a check of all four sides **A** of the oil pressure adjustment screw housing. There should be no cracks or oil in the area:

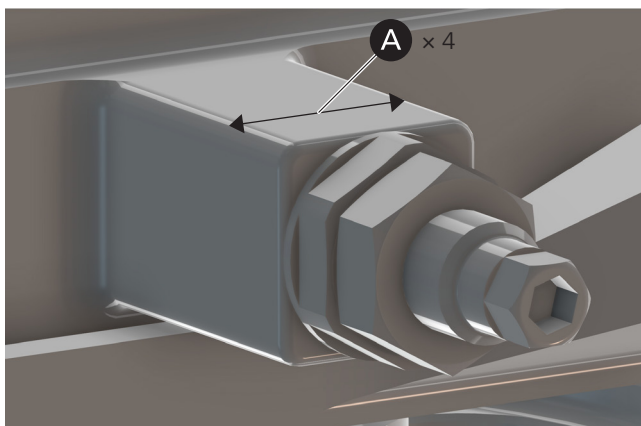



- If you find that there are no cracks and no oil leakage in the area, then no further action is required. Continue to **Install**.
- If you find that there are cracks and/or oil leakage in the area, continue to **Remove** to remove the oil pump and then install a new one.

Remove

1. Remove the engine oil pump, refer to:
 - Jesko, **WOM-00483**.
 - CC850, **WOM-00721**.

Install

1. Install in the reverse order.

Parts to be Returned

PARTS	REFERENCE	QUANTITY
Oil pump Jesko - 35mm	1077085	1

Warranty Information

If the repair is covered by the warranty terms, refer to Koenigsegg Warranty Process.

OPERATION

- KWO 408532 inspect the oil pump
- KWO 240634 inspect and replace the oil pump

PART NO

Refer to the invoiced kit number

