



# Service Bulletin

Bulletin No.: PIC6580A

Date: April, 2026

## PRELIMINARY INFORMATION

**Subject: Diagnostic Tip - Service Theft Alarm Message**

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	LYRIQ	2023 - 2026		All	All	All	All

<b>Involved Region or Country</b>	North America
<b>Condition</b>	A Customer may comment of a Service Theft Alarm message displaying on the DIC.
<b>Cause</b>	Possible circuit or terminal concern with circuit 728 or 1550 to the P18 Door Lock Status Indicator.

### Correction

Check for the P18 Door Lock Status Indicator located In the driver door panel, at top rear of door panel to be illuminated when the doors are locked.

If the indicator is inoperative, check circuits 728 and 1550 to the P18 Door Lock Status Indicator for an open circuit or terminal issues.

<b>Version</b>	1
<b>Modified</b>	10/17/2024 - Created on. 04/30/2026 - Updated model years.

