



Date: 27.04.2026 **Affected Models:** All Emira Powertrain 2023 - 2026 Selected Model Year VIN Range **Affected Regions:** Federal Market **Affected Volume:** 4175 **Number:** 131-26014

Copy files should be maintained by:

Service Manager		Service Reception		Supervisor		Parts Manager	
-----------------	--	-------------------	--	------------	--	---------------	--

TITLE

Fitment of tail lamp link lead harnesses to prevent rear tail lamp failure.

REASON

Under a specific usage condition* one or both of the rear tail lamps can stop illuminating.

*Hazard warning lights have been continuously activated for a prolonged time period with the ignition off and the tailgate closed.

Turning the ignition on or opening the tailgate will reactivate the position lights, but the turn indicator fault will remain. Only turning on the engine will reactivate the CEM and correct the turn indicator fault.

Link leads fitted between the engine compartment harness and rear lamp connector plugs are now fitted as a production running change to resolve this issue. These can also be ordered via the parts system on the Lotus Commercial Management System (LCMS).

Part Number	Description	Qty/Vehicle
8904408655*	Link Lead - Left Hand	1
8904408720**	Link Lead - Right Hand	1

*Part number may be displayed as 8801417994 on label attached to Link Lead - Left Hand.
 ** Part number may be displayed as 8801417993 on label attached to link Link Lead - Right Hand.

Note: The actions of this bulletin supersede the contents of Technical Service Bulletin TSB-131-26004 which affected 2024/2025 model year 4-cylinder vehicles only.

ACTION

- Check and identify any affected Emira vehicles from your inventory stock, dealer demonstrators and customer vehicles to ensure that this campaign action is performed at the first opportunity.
- Any affected vehicle’s campaign status will be displayed in the warranty section of LCMS.

Procedure:

- 1.Raise the vehicle, refer to the Emira service notes, Section 0 Introduction > 15 General Information > 016 Jacking > Raise and Support Vehicle - 2 Post Lift.
- 2.Remove 1 x M6 button headed screw and 1 x scrivit securing the rear of the wheelarch liner to the rear fender as shown in the image to sufficiently pull the wheelarch liner away from the fender.

Note: It is not necessary to remove the rear wheel or the complete wheelarch liner, only liner deflection to access the harness connectors is required.


- 3.Pull the left-side (driver side) rear of the wheelarch liner to gain access to the rear lamp to engine compartment harness connector.



Continued...



4. From the wheelarch area, pull the rear lamp to engine compartment harness connector mounting peg of from the subframe retaining stud (highlighted in orange).

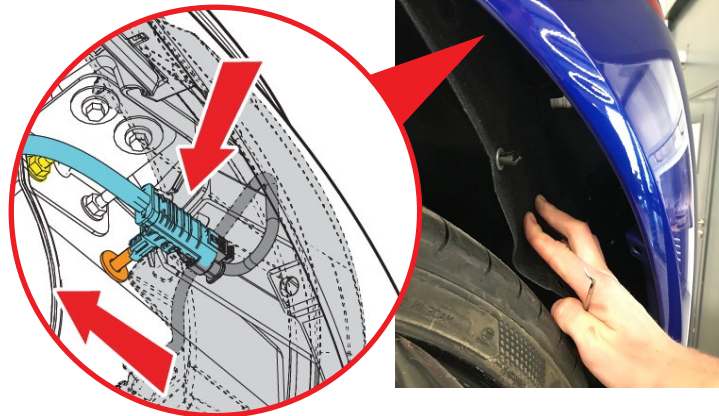

5. Pull the rear lamp to engine compartment harness connector mounting peg off the fender retaining stud.

6. Unplug the connectors.

NOTE: If campaign QBS-131-26004 was already carried out, then link lead part number 8901537030 previously fitted to both sides must be removed and discarded.

7. Fit the left hand (driver side) link lead (8904408655 highlighted in green), between the connectors.


NOTE: The link leads can be identified by their attached part number labels.

8. Fit the mounting peg of the tail lamp link lead harness onto the subframe retaining stud (highlighted in orange).

9. Fit the mounting peg of the engine compartment harness connector onto the subframe/fender bracket stud (highlighted in yellow).

10. Repeat the procedure on the right-hand (passenger side) rear tail lamp using link lead part number 8904408720.

11. Check the operation of all lights within the rear tail lamps.

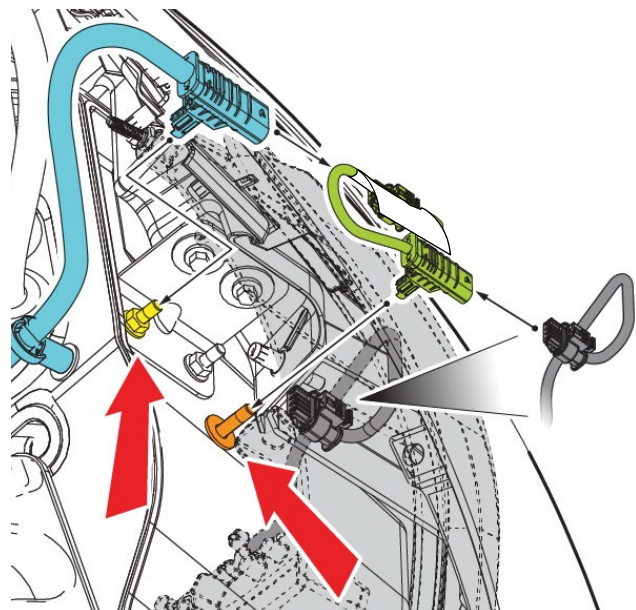

Continued...



The Emira service notes are available to view from the Lotus Service Technical Information System (TIS).

Warranty Declaration

This technical service bulletin is not intended as a recall procedure, nor will it have an affect on the vehicles warranty period.

Please perform the Campaign Agreement in LCMS which can later be converted into a Warranty Claim having the warranty type "Recall and Campaign".

This shall be raised in LCMS in under campaign ID QBS-131-26014.

CHARGES

A warranty claim may be submitted on Lotus Commercial Management System (LCMS), campaign number QBS-131-26014.

0.4 hours labour time per vehicle, plus 1 x 8904408655 Link Lead - Left Hand and 1 x 8904408720 Link Lead - Right Hand, using operation code 17.11.40-06, using A code 27 and B code 38.

Ends.