



SIB 64 12 24

FRONT CENTER DASH VENT ASSEMBLY – AIR SLAT REPAIR KITS

2026-05-04

This Service Information Bulletin (Revision 3) replaces SI B64 12 24 **dated February 2025**.

What's New:

- Model clarification

<input checked="" type="checkbox"/>	THIS REPAIR IS MOBILE FRIENDLY
<input type="checkbox"/>	THIS REPAIR IS REMOTE SOFTWARE UPGRADE (RSU) FRIENDLY

MODEL

 
F44 (2 Series Gran Coupe) produced after June 30th, 2021	F91 (M8 Convertible) produced after June 30th, 2021	F92 (M8 Coupe) produced after June 30th, 2021	F93 (M8 Gran Coupe) produced after June 30th, 2021
F95 (X5 M Sports Activity Vehicle)	F96 (X6 M Sports Activity Coupe)	F97 (X3 M Sports Activity Vehicle) produced after June 30th, 2021	F98 (X4 M Sports Activity Coupe) produced after June 30th, 2021
G01 (X3 Sports Activity Vehicle) produced after June 30th, 2021	G02 (X4 Sports Activity Coupe) produced after June 30th, 2021	G05 (X5 Sports Activity Vehicle) produced up to 4/2023)	G06 (X6 Sports Activity Coupe) produced up to 3/23)
G07 (X7 Sports Activity Vehicle) produced up to 3/23)	G14 (8 Series Convertible) produced after June 30th, 2021	G15 (8 Series Coupe) produced after June 30th, 2021	G16 (8 Series Gran Coupe) produced after June 30th, 2021
G20 (3 Series Sedan) produced after June 30th, 2021	G22 (4 Series Coupe) produced after June 30th, 2021	G23 (4 Series Convertible) produced after June 30th, 2021	G26 (4 Series Gran Coupe) produced after June 30th, 2021
G29 (Z4 Roadster) produced after June 30th, 2021	G42 (2 Series Coupe) produced after June 30th, 2021	G80 (M3 Sedan) produced after June 30th, 2021	G82 (M4 Coupe) produced after June 30th, 2021
G83 (M4 Convertible) produced after June 30th, 2021			

SITUATION

1. Use of aftermarket accessory hang-on cellular phone holders and/or air fresheners can break the instrument panel air vent slats.

Damage and/or issues caused by outside influences are not covered under the BMW limited warranties.

Originally, the air vent slats were only repairable by replacing the entire front center dash vent assembly; which in some applications, also included the IHKA control module.





2. The chromed end cap comes loose (shown missing within the circle):



CAUSE

The plastic vent slats were only designed to direct air for the climate control. They cannot support the additional weight of these aftermarket accessories.

CORRECTION

1. Replace damaged vent slats using the vehicle-specific vent slat repair kit. All vehicles.
2. Replace the chrome end cap. Only for F95, F96, G05, G06/G07 up to 3/23.

PROCEDURE


For detailed information on this repair see attached Video **BV640124 Vent Slat Repair Kits**

Follow ISTA Repair Instructions **64 22 250** Replace Air Vent, Center (Repair kit).


Each repair kit contains both driver and passenger vents with an alignment/installation tool for the **center vent** assembly. Only the outermost row of three vent slats are replaceable with this kit. The inner row of vent slats are only available with the entire climate control panel.



1. The vent slats can be replaced without removal of the climate control panel from the Instrument Panel. The jig that holds the vent slats is color coded for left (white) and right (black).

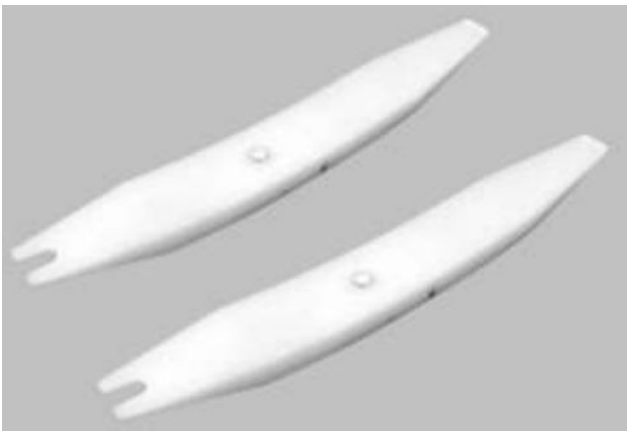

Special tool 2 298 505 (shown; aka “bone tool”) and a pair of thin long-nose pliers are required.

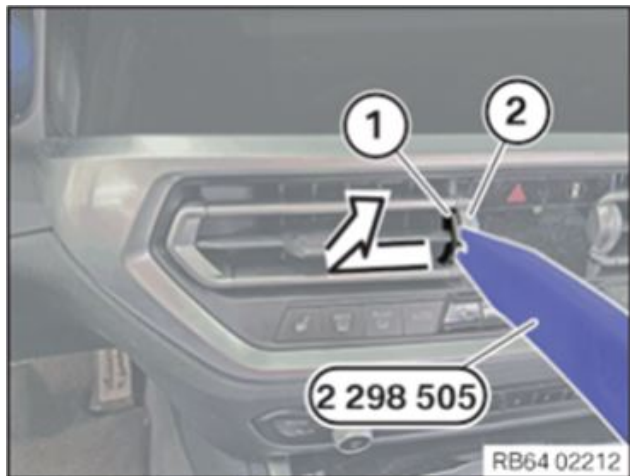

To release the vent slats from the knurled wheel, insert the bone tool 2 298 505 between the black plastic end cap on the vent slats and the chrome knurled wheel and pry gently outward.

- The black plastic end cap has a small button sticking out that keeps it retained in the knurled wheel

Then release the front center slat from the rear slats and slide the three front slats out of the chromed end cap.



2. To replace the chrome end cap, the climate control panel must be removed from the dashboard.

The white plastic locking clip is attached from the rear of the panel.

Only for F95, F96, G05, G06/G07 up to 3/23.

PARTS INFORMATION

Part Number	Description	Quantity
64 11 5 B55 148	Air Vent Center (Repair kit) F91 F92 F93 G14 G15 G16 (ONLY for vehicles produced AFTER 6/30/2021)	1
Or:		
64 11 5 B55 149	Air Vent Center (Repair kit) F95, F96, G05, (G06/G07 up to 3/23, not for LCI) – includes chrome end cap repair	1
Or:		
64 11 5 B55 150	Air Vent Center (Repair kit) F44 F97 F98 G01 G02 G20 G22 G23 G26 G29 G42 G80 G82 G83 (ONLY for vehicles produced AFTER 6/30/2021)	1

CLAIM INFORMATION

This Service Information Bulletin provides technical, and alternate repair information.

Damage and/or issues caused by outside influences are not covered under the BMW limited warranties.

FEEDBACK REGARDING THIS BULLETIN

Technical Feedback	To submit feedback for the technical topic of this bulletin: Submit your feedback in the rating box at the top of this bulletin
Warranty Feedback	To submit feedback for the CLAIMS section of this bulletin: Submit an IDS ticket to the Warranty Department, or use the chat available in the Warranty Documentation Portal

Parts Feedback	To submit feedback for the PARTS section of this bulletin: Submit an IDS ticket to the Parts Department
----------------	---

Supporting Materials

Videos

[64 01 24](#)