



TECHNICAL SERVICE BULLETIN

Carpet Loose Or Torn

26-2205

15 May 2026

This bulletin supersedes 25-2346. Reason for update: add Bronco Sport and Escape vehicle lines, add labor operations to repair the rear right/left carpet area, and update the service procedure and part description.

Model:

Ford 2021-2025 Bronco Sport
2020-2025 Escape
Lincoln 2020-2025 Corsair

Markets: North American markets only

Issue: Some of the vehicles listed in the Model statement above may exhibit a condition where the carpet is loose or torn near the front/rear scuff plate trim panel. This may be due to the carpet tearing at or near the retainer hole.

Action: For vehicles that meet all of the criteria in the Issue and Model statements, follow the Service Procedure to repair the carpet tear.

Parts

Service Part Number	Claim Quantity	Description
PJ7Z-9913132-A	1 Per Affected Side	Carpet Pad Retainer

Claim Quantity refers to the total number of individual pieces required to repair the vehicle. This may differ from the number of service part number packages due to the unit of issue (UOI).

As Needed indicates the part is necessary but amount of the part may vary and/or is not a whole number. Parts can be billed out as non-whole numbers, including less than 1.

Only If Necessary indicates the part is not mandatory. Refer to the Service Procedure to determine the inspection/inclusion criteria.

Warranty Status: Warranty coverage limits and policies are not altered by a TSB. Warranty coverage limits are determined by the identified causal part.

Labor Times

Description	Operation No.	Time
2020-2025 Escape/Corsair; 2021-2025 Bronco Sport: Repair The Carpet On The Right Front Of The Vehicle Following The Service Procedure (Can Be Claimed With D, E Or F)	262205A	0.3 Hrs
2020-2025 Escape/Corsair; 2021-2025 Bronco Sport: Repair The Carpet On The Left Front Of The Vehicle Following The Service Procedure (Can Be Claimed With D, E Or F)	262205B	0.4 Hrs
2020-2025 Escape/Corsair; 2021-2025 Bronco Sport: Repair The Carpet On Both The Right Front And Left Front Of The Vehicle Following The Service Procedure (Can Be Claimed With D, E Or F)	262205C	0.6 Hrs
2020-2025 Escape/Corsair; 2021-2025 Bronco Sport: Repair The Carpet On The Right Rear Of The Vehicle Following The Service Procedure (Can Be Claimed With A, B Or C)	262205D	0.3 Hrs
2020-2025 Escape/Corsair; 2021-2025 Bronco Sport: Repair The Carpet On The Left Rear Of The Vehicle Following The Service Procedure (Can Be Claimed With A, B Or C)	262205E	0.3 Hrs
2020-2025 Escape/Corsair; 2021-2025 Bronco Sport: Repair The Carpet On Both The Right Rear And Left Rear Of The Vehicle Following The Service Procedure (Can Be Claimed With A, B Or C)	262205F	0.4 Hrs

2020-2025 Escape/Corsair; 2021-2025 Bronco Sport: Repair The Carpet On Both Front/Rear And Both Right And Left Sides Of The Vehicle Following The Service Procedure (Do Not Use With Any Other Labor Operations)

262205G

0.9
Hrs

Repair/Claim Coding

Causal Part:	7813000
Condition Code:	33

Service Procedure

1. Remove the front/rear scuff plate trim panel from the vehicle to expose the loose carpet area. Refer to the [WSM](#), Section 501-05 Interior Trim and Ornamentation > Removal and Installation. (Figures 1-2)

Figure 1



E457561

Figure 2



E457562

2. Place the carpet pad retainer to a convenient position, use push pins as guides to align the carpet pad retainer with the carpet. (Figure 3)

Figure 3



E457563

3. Using a suitable stapler, apply staples to firmly attach the carpet pad retainer to the carpet. (Figure 4)
Figure 4



E457564

(1). Staples should only be applied under the area covered by the scuff plate trim panel to make sure the staples are not visible.

4. Once the carpet pad is securely attached, reinstall the scuff plate trim panel and make sure the staples are covered. Refer to the WSM, Section 501-05. (Figure 5)

Figure 5



E457565

© 2026 Ford Motor Company

All rights reserved.

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.