



Service Bulletin

Bulletin No.: PIP6071C

Date: May, 2026

PRELIMINARY INFORMATION

Subject: Potential Chuggle, Surge, Hesitation on Acceleration, P2097, P2251, P223C

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Equinox	2023-2026		All	All	1.5 LSD	All
GMC	Terrain	2023-2026		All	All	1.5 LSD	All

Involved Region or Country	North America
Condition	Customers may notice a surge, chuggle, hesitation at tip in acceleration or MIL with, P2097, P2251 P223C stored. More noticeable on units built prior to April 1, 2025.
Cause	Potential skewed position 1 oxygen sensor.

Correction

Replace the position 1 oxygen sensor, perform any applicable learn, and retest. Inspect the catalytic converter while sensor is out of the bore for any potential degradation to the catalyst bed.

Parts Information

Refer to GM EPC for parts information per specific VIN.

Version	4
Modified	06/13/2025 created on. 06/30/2025 Update to add Model Year 2026 10/20/25 Update to the condition 05/15/2026 Updated to the Title and condition sections

