



# Service Bulletin

Bulletin No.: PIT6222A

Date: May, 2026

## PRELIMINARY INFORMATION

**Subject: Diagnostic Tip Ticking Or Clicking Noise Coming From The Rear HVAC**

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade	2023 - 2024		All	All	All	All
Cadillac	Escalade ESV	2023 - 2024		All	All	All	All
Chevrolet	Suburban	2023 - 2024		All	All	All	All
Chevrolet	Tahoe	2023 - 2024		All	All	All	All
GMC	Yukon	2023 - 2024		All	All	All	All
GMC	Yukon XL	2023 - 2024		All	All	All	All

<b>Involved Region or Country</b>	North America
<b>Condition</b>	Some customers may comment that there is a clicking/ticking type noise coming from the rear of the vehicle.
<b>Cause</b>	This concern may be caused by the rear mode door binding where it passes through the rear HVAC case.

### Correction

1. Gain access to the rear HVAC mode actuator and remove from the case.
2. Try and move the mode door by hand. The door should move freely with no binding feel at all.

If there is any binding in the mode door, the rear HVAC upper case will need to be replaced.

### Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4412330	Blower Upper Case Replacement	Use Published Labor Operation Time

Version	2
Modified	08/21/2024 - Created on. 05/13/2026 - Updated The Warranty Information.

