

MAS005162 RU 26-08

RAPID UPDATE

FROM: Maserati TSO

TO: Maserati Network



Maserati

PERSONAL SERVICE LAB

MASTERS OF CARE

Rapid Update 819 MC20 – BCM SW Update



IMPORTANT NOTICE This bulletin supersedes MAS005090 RU 26-06 released on March 24, 2026. It includes updated information. Please discard all previous versions.

DATE: May 12, 2026

Certain Maserati vehicles listed in MODISCS+ are involved in a Rapid Update to update the Body Control Module (BCM) Software.

VEHICLES INVOLVED: MC20 (M240), Model Years 2023–2026

Some vehicles may exhibit a concern related to the **Remote Start timer**. In these cases, the Body Control Module (BCM) may not correctly align the expected timer behavior with the vehicle's actual response time. This timing mismatch can interrupt the procedure and cause the remote start function to fail. A software update is required to correct the timer settings and ensure the Remote Start procedure completes successfully.

We remind you that all the Rapid Updates must be performed within the first workshop visit, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for vehicles in Stock Dealer / PDI, it is necessary to carry out all action operations before delivery to the end customer, as required by the White Book and explicitly reported in the Pre-delivery checklist.

Please read and review this bulletin first before ordering parts and/or starting the procedure.

Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions.

Thank You for your continued support and cooperation.

Maserati Americas
Aftersales Dept.

Technical Procedure



All images shown in this bulletin are for illustrative purposes only

Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.

Prerequisites Before Beginning the Software Update

Before starting the update procedure, ensure the following conditions are met:

- **Connect the E-XTEQ MAXIMUS** to maintain the required system voltage and current throughout the update. *(Required)*
- **Ignition ON, Engine OFF.**
- **Vehicle parked with the SGW unlocked.**
- **MD-Evo scan tool software version 9.8.2 or newer** must be installed.
- **Follow all on-screen prompts provided by the MD-Evo scan tool** during the procedure.

BCM Programming

- 1) With the engine OFF and the battery charger connected, launch the EVO Sw.
- 2) Navigate to **BCM – ECU Programming** and perform the software update.

Software version to be installed (or newer).

ECU	F188 - VM SW Number
BCM	670360982

- (a) **IMPORTANT:** Some vehicles require a **Vehicle Configuration (VC)** procedure. Refer to the attached VIN list to determine whether this action is required. For vehicles marked with a “NO” in the list, **skip over to Step 3.**

Use the attached VIN list to verify the correct actions to be performed for each VIN

Complete VIN	VIN	Vehicle Configuration
ZAMBMRAB1S0458968	458968	YES
ZAMBMRAB0S0458962	458962	YES
ZAMBMRAB2S0458963	458963	YES
ZAMBMSAB0S0458967	458967	YES
ZAMBMSAB2S0459649	459649	NO
ZAMBMSAB1S0460310	460310	NO

- (b) Using MD-EVO, run **BCM – Procedure - Write Vehicle Configuration**



- 3) After the programming completes, run: **BCM → Procedures → PROXI Alignment**
- 4) Once complete, the vehicle can be released.

Warranty Claim Information

Please complete the warranty request as follows:

Description	Code
Rapid Update Number	819
Warranty code	23
Error code	063
Component Code	8.61.035
Operation Code <ul style="list-style-type: none"> ▪ SW Update 	8.61.035.A (0.20 h)