



Service Bulletin

Bulletin No.: PIT6366C

Date: May, 2026

PRELIMINARY INFORMATION

Subject: Diagnostic Tip - Turn Signal Activated Camera View

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade	2025-2026		All	All	All	All
Cadillac	Escalade ESV	2025-2026		All	All	All	All
Chevrolet	Silverado EV	2026		All	All	All	All
Chevrolet	Suburban	2025-2026		All	All	All	All
Chevrolet	Tahoe	2025-2026		All	All	All	All
GMC	Sierra EV	2026		All	All	All	All
GMC	Yukon	2025-2026		All	All	All	All
GMC	Yukon XL	2025-2026		All	All	All	All

Involved Region or Country	North America
Additional Options (RPO)	TRG - Trailer Camera Provisions / UV2 - HD Surround Vision Camera
Condition	A customer may comment that Turn Signal Activated View may not be working with or without a trailer connected.
Cause	The vehicle must be equipped with RPO TRG Trailer Camera Provisions for the Turn Signal Activated View to work with or without a trailer connected

Correction

If the vehicle is not equipped with RPO TRG it does not have this feature.

If the vehicle is equipped with RPO TRG and Turn Signal Activated Camera View with no trailer connected is not working, reprogram the Radio per latest version of 25-NA-021 Radio Software Update W23E-178.1.2-M174-SQBR6-93.3.

Note: Some Models may have had calibrations from the factory that enabled Turn Signal Activated View without having RPO TRG. A customer may comment that the system was operating and then stopped operating after an OTA was accepted or after the Image Processing Module was replaced or reprogrammed. Engineering is aware of this concern and sometime in the near future an OTA will be released to enable Turn Signal Activated View on select Vehicle Models. The PI will be updated to inform dealers once the OTA has been released.

Version	4
Modified	04/07/2025 - Created on. 10/10/2025 - Updated Models and Model Year 01/23/2026 - Updated Model Years 05/19/2026 - Added note to correction information

