

|  |                                 |
|--|---------------------------------|
| <b>Subject:</b><br><br><b>RATTLING NOISE FROM SECOND SEAT UNDER VARIOUS VEHICLE SPEEDS AND ROAD CONDITIONS</b> | <b>Bulletin No.:</b> 09-017/26  |
|  | <b>Last Issued :</b> 05/20/2026 |

## BULLETIN NOTES

### APPLICABLE MODEL(S)/VINS

2024-2026 CX-90 with VINS lower than JM3KK\*\*\*\*\*390346 (produced before March 17, 2026)

2025-2026 CX-70 with VINS lower than JM3KJ\*\*\*\*\*352226 (produced before March 17, 2026)

### DESCRIPTION


Some customers may complain that a rattling noise is heard from the second seat while driving under various vehicle speeds and road conditions. This is caused by the hinge cover of the second seat becoming deformed, resulting in looseness and a rattling noise.

To eliminate this concern, the structure of the second seat hinge cover was revised to increase strength and prevent deformation.

Customers having this concern should have their vehicle repaired using the following repair procedure.





### REPAIR PROCEDURE

1. Verify the customer concern.
2. Replace the armrest hinge cover with the improved part according to the procedure below.
  - a. Remove the back panel trim.
    - (1) Remove the rear back panel lower finisher.
    - (2) Lift the inner side fastener (clip).

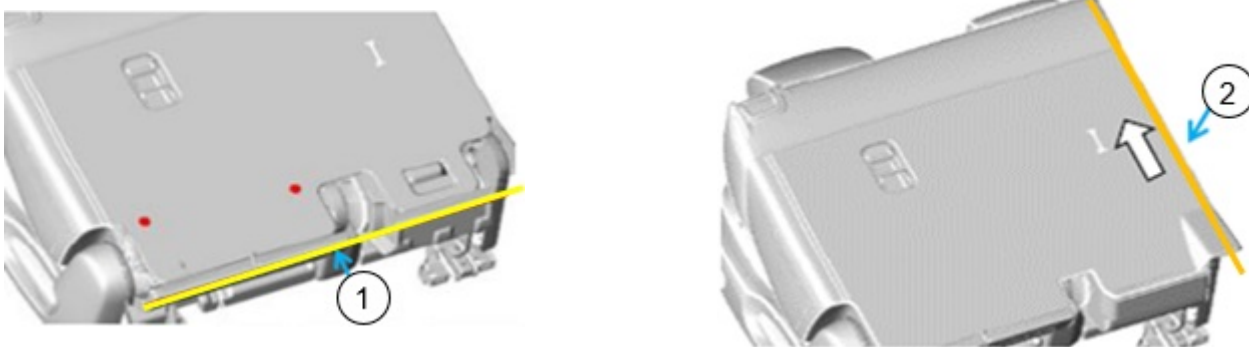


**CONSUMER NOTICE:** The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

- b. Remove the armrest. (1) Remove the bolt that secures the armrest by inserting a socket wrench into the slit in the urethane. (Socket size: 10 mm)  
(2) Lift the armrest upward to disengage the shaft from the bracket.  
(3) Pull the armrest diagonally to remove it from the vehicle.  
(4) At this time, the armrest rotation shaft will come off.

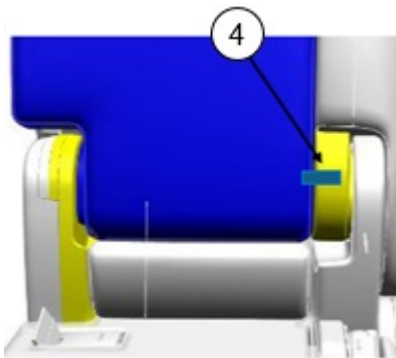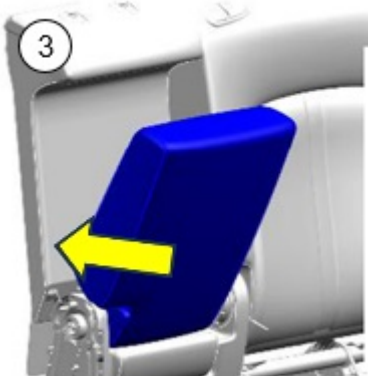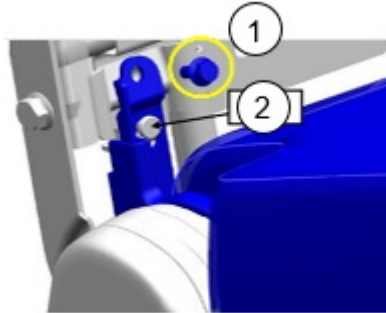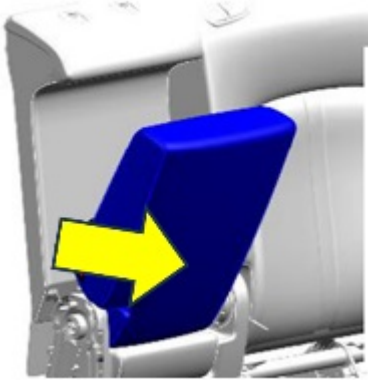

**CONSUMER NOTICE:** The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

- c. Replace the armrest hinge cover. (1) Peel back the back trim and remove the screw.  
 (2) Release the engagement portions (claw engagements).

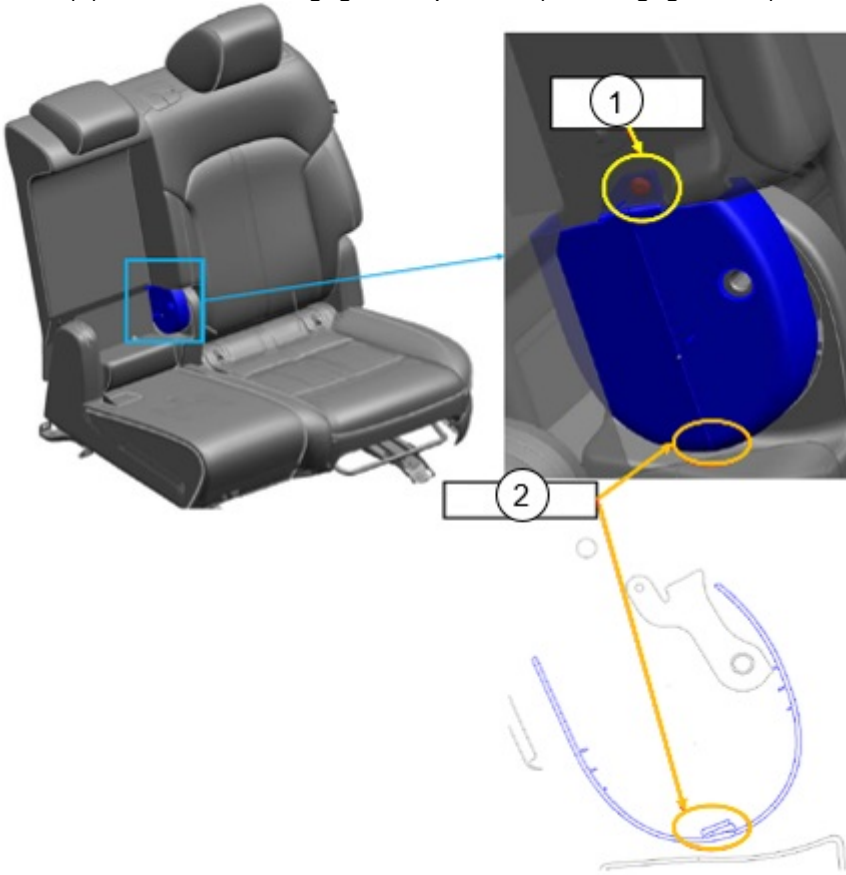

3. Verify the repair.

#### PARTS INFORMATION

| Parts Number   | Description      | Qty. | Notes      |
|----------------|------------------|------|------------|
| KMV6-88-031A02 | CVR-HINGE, R, #1 | 1    | Black      |
| KMV6-88-031A39 | CVR-HINGE, R, #1 | 1    | Pure White |
| KMV6-88-031A18 | CVR-HINGE, R, #1 | 1    | Red        |
| KMV6-88-031A23 | CVR-HINGE, R, #1 | 1    | Tan        |
| KMV6-88-031A34 | CVR-HINGE, R, #1 | 1    | Sand       |

**NOTE:** Utilize the GEPC by entering the VIN to identify the appropriate part number.

**CONSUMER NOTICE:** The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical--including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

**WARRANTY INFORMATION****NOTE:**

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

|                                 |                     |
|---------------------------------|---------------------|
| Warranty Type                   | A                   |
| Symptom Code                    | 82                  |
| Damage Code                     | 9B                  |
| Part Number Main Cause          | KMV6-88-031A*       |
| Quantity                        | 1                   |
| Operation Number / Labor Hours: | XXX5ZXRX / 0.4 Hrs. |

**NOTE:**

- Claim the parts other than "Causal Parts No." as related parts , if required.
- Submit claims for maintenance and adjustments according to the "Suggested Repair Time (SRT)" in MGSS if required.

**CONSUMER NOTICE:** The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.