

Uncontrolled Copy

ID # CBR-2585

Version 1

Title

C106718 and/or C106818 DTC - VN (4) - AN (4) - PR

Abstract

The purpose of this CBR is to provide support for fault codes C106718 and/or C106818.

Content

Published 13 May 2026

Valid For

Mack Chassis - AN (4), PR


Volvo Chassis - VN (4)

Model Year - 2024 to current


The purpose of this CBR is to provide support for fault codes C106718 and/or C106818.

When fault codes C106718 and/or C106818 are present, and/or it has been identified that the wheel speed sensor harness is contacting the shock, please follow the instructions below before releasing the unit.

1. Cut the zip ties and removed the harness from the wheel speed mounting bracket. Then remove bracket from the truck.

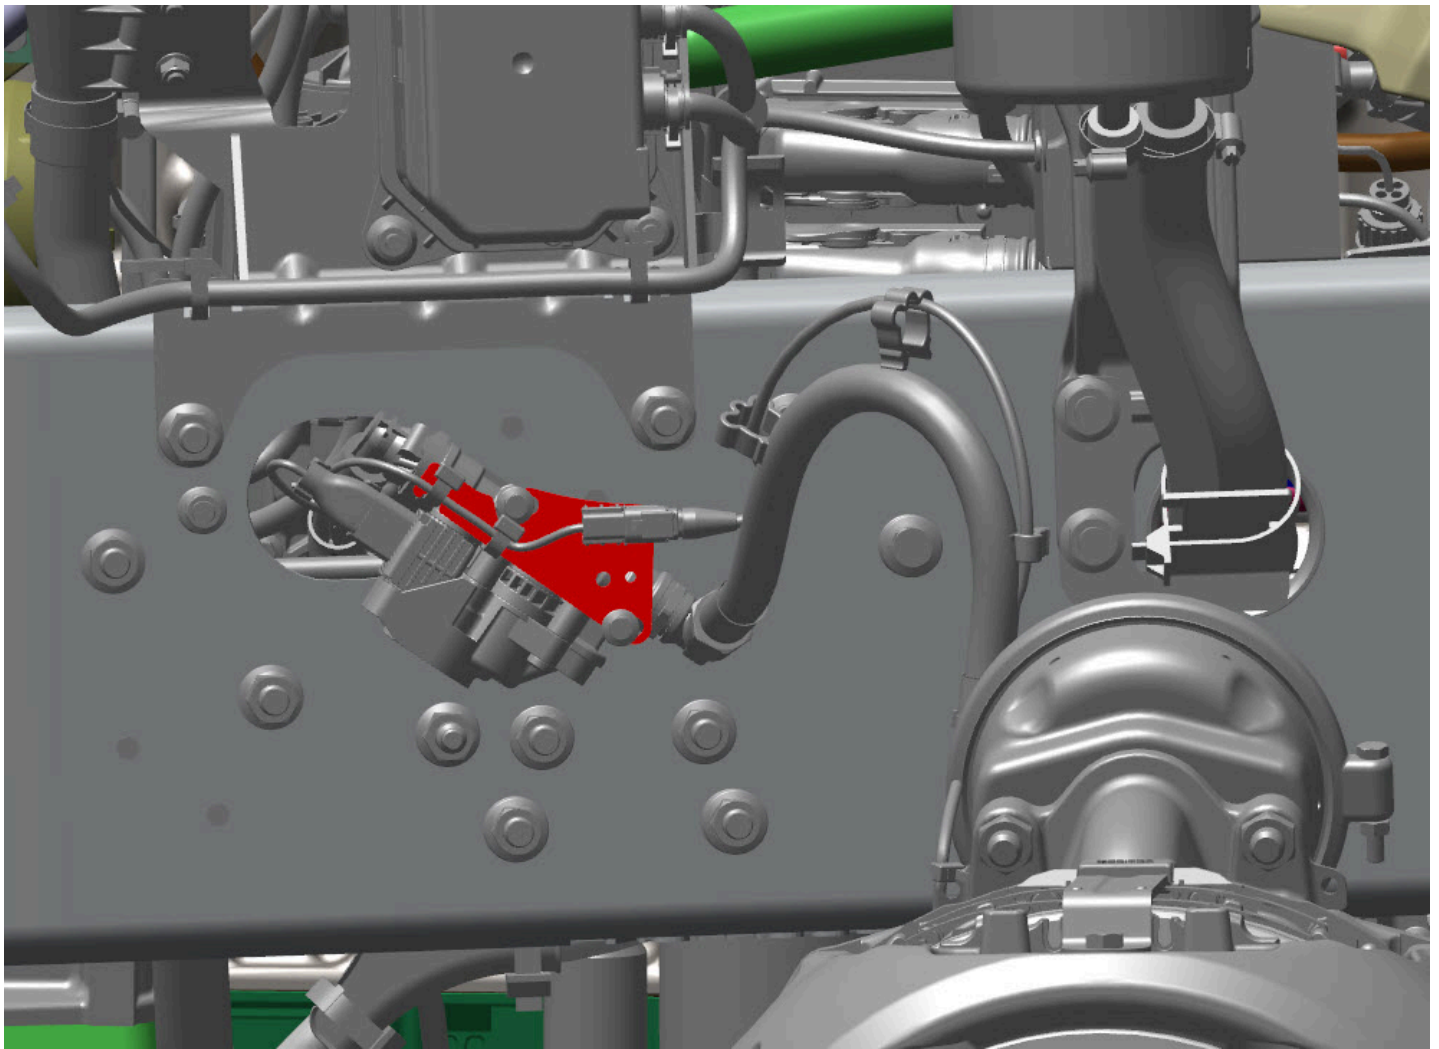

2. Use the drawing below to drill new holes for the harness routing.

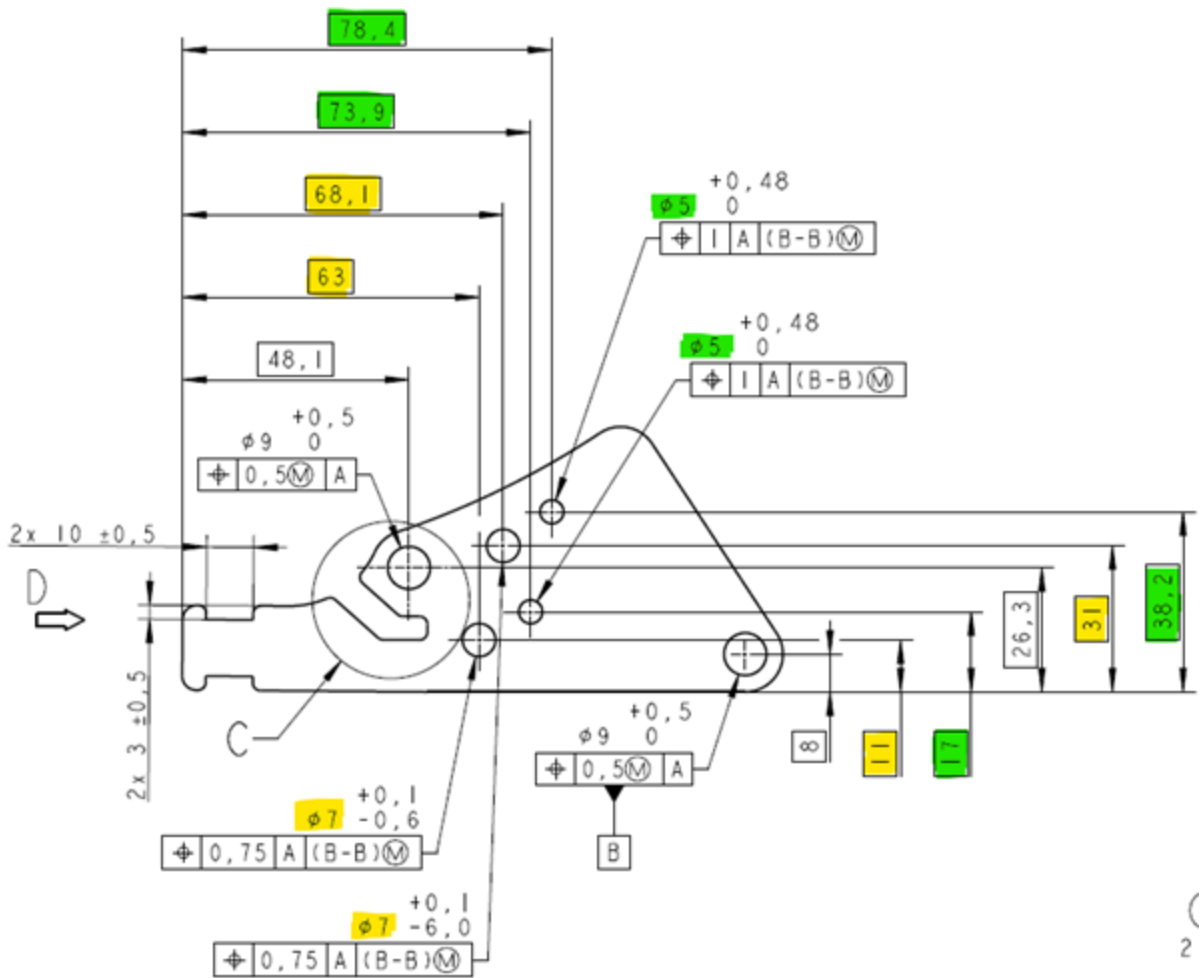

Note: Yellow tags are to be drilled with 7mm drill bit
 Green tags are to be drilled with 5mm drill bit

3. Once the holes are drilled, reinstall on the truck.
4. Install harness to the bracket using the new holes. Ensure the harness is not contacting the shock.

Tags

an4 an 4 mack pr rub rubbing
 vn4 vn 4 volvo wheel speed sensor wss

Categories *

- Make and Model > Volvo > VN (4)
- Make and Model > Mack > PR - Pioneer
- Make and Model > Mack > AN (4) - Anthem
- Vehicle System > Wheel and Hub
- Vehicle System > Brakes

Live UI