



TECH TIP

ID No. TT-26-003
Ref. No. TECH ASSIST
Release Date 5-6-2026

TT-26-003 COE HV Battery Thermistor DTC P3001 - TC43

OVERVIEW

When servicing a COE Hybrid with the HV light on and code P3001 - TC43 set. Diagnosis has led to replacing the Battery ECU and/or the HV Battery. We have found that replacing the HV Battery Thermistor has resolved this concern in most cases.

SUBJECT VEHICLES

Certain 13MY – 20MY Hybrid Cab-Over equipped with a J05

WARRANTY TERMS

This TechTip is for information only, it does not imply any warranty

REPAIR PROCEDURE

Replace the HV battery thermistor harness. G9282-37010 located in the HV Battery compartment.