

**Technical Service Bulletin (TSB)**  
**Application Of Grease In Pads/Clips**

<b>REFERENCE:</b>	<b>TSB:</b> 05-001-26 REV. A <b>GROUP:</b> 05 - Brakes	<b>Date:</b>	May 30, 2026	<b>REVISION:</b>	05-001-26
<b>VEHICLES AFFECTED:</b>	<b>2020 - **2026** (WD) Dodge Durango</b> This bulletin applies to vehicles equipped with Anti-Lock 4-Wheel Disc HD Brakes (Sales Code BR6) and: <ul style="list-style-type: none"> <li>• 3.6L V6 24V VVT Engine Upg I w/ESS (Sales Code ERC). OR</li> <li>• 5.7L V8 HEMI MDS VVT Engine (Sales Code EZH).</li> </ul>			<b>MARKET APPLICABILITY:</b> <input checked="" type="checkbox"/> NA <input type="checkbox"/> MEA <input type="checkbox"/> SA <input type="checkbox"/> IAP <input type="checkbox"/> EE <input type="checkbox"/> CH <b>NOTE:</b> This bulletin applies to the North America market.	
<b>CUSTOMER SYMPTOM:</b>	<b>Customer may experience one or more of the following:</b> <ul style="list-style-type: none"> <li>• Brake pulsation/vibration.</li> <li>• Squealing/squeaking/grinding noise when braking.</li> <li>• Vehicle pulls to one side when braking.</li> </ul>				
<b>CAUSE:</b>	Sticking Inner Brake Pads				

This bulletin supersedes Technical Service Bulletin (TSB) 05-001-26, date of issue May 14, 2026, which should be removed from your files. All revisions are highlighted with **\*\*asterisks\*\*** and include updated vehicle model years and new LOP.

**REPAIR SUMMARY:**

This bulletin involves lubricating the brake pad anchors.

**CLAIMS DATA:**

Labor Operation No:	Labor Description	Skill Category	Labor Time
**05-70-22-9Y	Front Brake Pads - Lube Pad Anchors (2 - Skilled)	05 - Brakes	0.6 Hrs.**
Failure Code	ZZ	Service Action	

**SPARE PARTS:**

Qty	Part No.	Description	Notes
1 (AR)	05019061AB	Brake And Suspension Grease	MS 7751 - Fluorocarbon Gel 800 - Nye Lubricants

**NOTE:** MS 7751 - Fluorocarbon Gel 800 - Nye Lubricant tube will service 31 vehicles.

## DIAGNOSIS:

If the customer describes the symptom/condition listed above, perform the Repair Procedure.

## REPAIR PROCEDURE:

1. Remove the front brake pads. Refer to the detailed service procedures listed in DealerConnect>Service Library under: 05 - Brakes / 05 - Brakes, Base / Hydraulic/Mechanical / Pads and/or Shoes, Brake / Removal.
2. Lubricate the inner pad anchor slides with 05019061AB brake and suspension grease.
3. Re-install the front brake pads. Refer to the detailed service procedures listed in DealerConnect>Service Library under: 05 - Brakes / 05 - Brakes, Base / Hydraulic/Mechanical / Pads and/or Shoes, Brake / Installation.

## POLICY:

Reimbursable within the provisions of the warranty.

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.*