



Date: 27.05.2026 **Affected Models:** Emira Selected 2023 - 2025 Model VIN Range **Affected Regions:** All Markets **Affected Volume:** 10669 **Number:** 131-26015

Copy files should be maintained by:

Service Manager		Service Reception		Supervisor		Parts Manager	
-----------------	--	-------------------	--	------------	--	---------------	--


TITLE

Checking the pyrotechnic seat belt pre-tensioner harness connector for security.

REASON

The SRS (Supplementary Restraint System) seat belt pre-tensioner harness connectors are fitted with locking tabs to ensure their security to their pre-tensioner/seat belt reel assemblies.

It cannot be confirmed if the locking tabs to the 2023 - 2025 model year VIN range* have been correctly secured during the production build process.

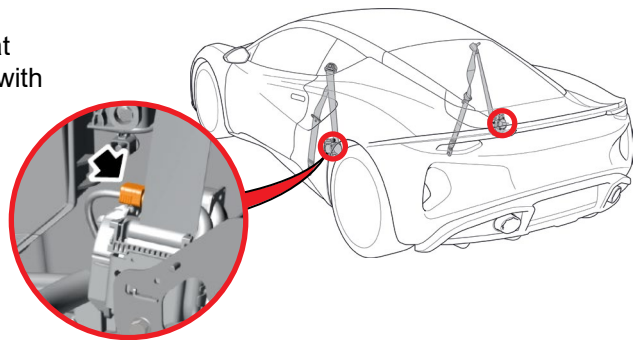

*Safe VIN from SCCLEJAX1SHA11255.

There is a possibility that the harness connectors may loosen or disconnect if the locking tabs are not secured, which may result in inoperative seat belt pre-tensioners and a warning message being displayed in the driver display module (SRS Service Required).

Note: The mechanical locking functionality of the seat belts will still operate as normal even if the warning message is displayed.

ACTION

- Check and identify any affected Emira vehicles from your inventory stock, dealer demonstrators and customer vehicles to ensure that this campaign action is performed at the first opportunity.
- Any affected vehicle's campaign status will be displayed on the Lotus Commercial Management System (LCMS).

Procedure



Remove the rear quarter insert trim quick access panels from behind the driver and passenger seats. Inspect and if necessary push any unsecured locking tabs back into position.

Continued...



Bulletin number 131-26015
continued page 2

Warranty Declaration

This technical service bulletin is not intended as a recall procedure, nor will it have an affect on the vehicles warranty period.

Please perform the Campaign Agreement in LCMS which can later be converted into a Warranty Claim having the warranty type "Recall and Campaign".

This shall be raised in LCMS in under campaign ID QBS-131-26015.

CHARGES

A warranty claim may be submitted on Lotus Commercial Management System (LCMS), campaign number QBS-131-26015.

Check left and right hand seat belt harness locking tab connectors for security:

Operation code 13.27.15-00 - Seat belt Harness Connector Check - 0.25hrs labour/vehicle.

Use A code 20, B code A7.

Ends.