



# Service Bulletin

Bulletin No.: PIT6477C


Date: June, 2026

## PRELIMINARY INFORMATION

**Subject: Unable to Perform GDS2 Automated Bleed After Master Cylinder Replacement**

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade	2021-2026		ALL	ALL	ALL	ALL
Cadillac	Escalade ESV	2021-2026		ALL	ALL	ALL	ALL
Cadillac	ESCALADE IQ	2025-2026		ALL	ALL	ALL	ALL
Cadillac	ESCALADE IQL	2026		ALL	ALL	ALL	ALL
Chevrolet	Silverado 1500	2022-2026		ALL	ALL	ALL	ALL
Chevrolet	Silverado EV	2024-2026		ALL	ALL	ALL	ALL
Chevrolet	Suburban	2021-2026		ALL	ALL	ALL	ALL
Chevrolet	Tahoe	2021-2026		ALL	ALL	ALL	ALL
GMC	HUMMER EV	2022-2026		ALL	ALL	ALL	ALL
GMC	HUMMEV EV SUV	2024-2026		ALL	ALL	ALL	ALL
GMC	Sierra 1500	2022-2026		ALL	ALL	ALL	ALL
GMC	Sierra EV	2024-2026		ALL	ALL	ALL	ALL
GMC	Yukon	2021-2026		ALL	ALL	ALL	ALL
GMC	Yukon XL	2021-2026		ALL	ALL	ALL	ALL

<b>Involved Region or Country</b>	North America
<b>Condition</b>	Some Technicians may notice that they get an error screen when trying to perform the automated bleed after master cylinder replacement, (See Error Screen Below).
<b>Cause</b>	Software Anomaly with GDS2 Software.

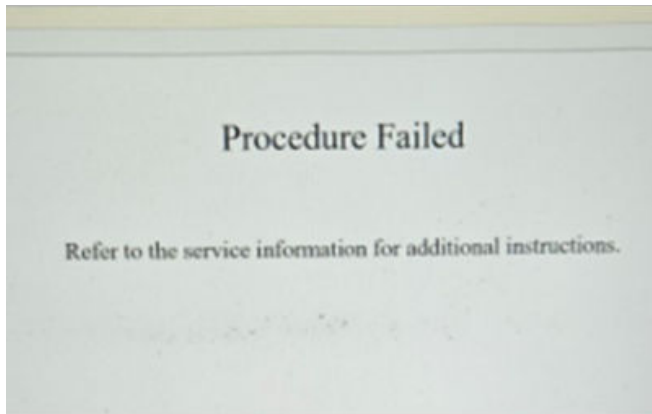

7058016

### Correction

An updated version of GDS2 has been released to address this issue. Please launch Techline Connect (TLC) and verify that GDS2 is updated to GM Global version v2026.05.31 or later.

When performing the GDS2 Auto Brake Bleed procedure, you will now see two options: "Automated Brake Bleed" and "Modified Automated Brake Bleed."

Begin by selecting "Automated Brake Bleed." If the procedure completes successfully, no further action is required.

If the "Automated Brake Bleed" procedure does not complete successfully, proceed with "Modified Automated Brake Bleed," which incorporates the updated fix.

<b>Version</b>	4
<b>Modified</b>	01/26/2026- Created on 01/30/2026- Updated to add additional note to correction field 02/17/2026-Updated to add the repair procedure 06/05/2026-Updated to add models

