



SSM 54888 2025-2026 Expedition/Navigator – Passenger Side Mirror Autofold Feature Inoperative - Built On Or Before 10-Mar-2026

Some 2025-2026 Expedition/Navigator vehicles built on or before 10-Mar-2026 and equipped with power autofold exterior mirrors may exhibit concerns with the passenger mirror not automatically folding in or out at times, while the driver side mirror automatically folds properly. This may be due to the software in the driver door module (DDM) and passenger door module (PDM). To correct the condition, reprogram the DDM and PDM using the latest software level of the Ford Diagnosis and Repair System (FDRS) scan tool. For claiming, use causal part 14B291 and labor operation MT14B291SSM up to 0.4 hours.