



SSM 54992 2024-2026 Bronco - Various Trailer Module (TRM) Concerns

Some 2024-2026 Bronco vehicles may exhibit various TRM concerns when attempting first time installation of a dealer installed accessory TRM, including one or more of the following:

- TRM unable to be programmed
- Trailer lights inoperative
- DTC U2100 stored in the TRM

This may be due to any of the following conditions:

-The incorrect trailer tow kit is being installed. The TRM is model year specific. Refer to the parts catalog using the VIN and base part number 15A416 for the vehicle specific trailer tow kit.

-The "TRM - Trailer Module (TRM) Configuration" application being run instead of the "Towbar Configuration" application during first time TRM installation using the Ford Diagnosis and Repair System (FDRS). Dealer installed accessory TRMs are preprogrammed and only the "Towbar Configuration" application should be run during first time TRM installation to configure the TRM properly and support proper function of trailer tow capabilities. Any attempts to program the TRM using the "TRM - Trailer Module (TRM) Configuration" application after installation of a dealer installed accessory TRM could result in a damaged TRM. Refer to the vehicle identification number (VIN) specific trailer tow kit installation instructions in Professional Technician System (PTS) > Workshop > Accessories > Installation.

-The FDRS scan tool version is not at the latest software level. To correct this condition, download and install the latest software version of FDRS, then run the "Towbar Configuration" application.