

26PACB: Medium Duty Battery Electric Vehicle DANA Cradle Harness Connector

Number	 Edit  Clone
26PACB / Transport Canada: 2026-256	
Supplier	
DANA	
Date	
7/2/2026	

What's New

Certain Kenworth K270 and K370 Battery Electric Vehicle (BEV) chassis equipped with certain DANA cradle harnesses may intermittently lose electrical continuity at one or more C40 connector pins. This can occur without warning and cause loss of propulsion, increasing the risk of a crash.

Certified BEV technicians will inspect the C40 connector and replace the cradle harness, if necessary. This safety recall defect is identical to 25KWD and applies to certain Canadian chassis added on 07/02/2026.

Introduction

Certain Kenworth K270 and K370 Battery Electric Vehicle (BEV) chassis equipped with certain DANA cradle harnesses may intermittently lose electrical continuity at one or more C40 connector pins. This can occur without warning and cause loss of propulsion, increasing the risk of a crash.

Certified BEV technicians will inspect the C40 connector and replace the cradle harness, if necessary.

This safety recall defect is identical to 25KWD and applies to certain Canadian chassis added on 07/02/2026.

Situation

2 Canada vehicle model year 2024 and 2026 K270 BEV and K370 BEV chassis manufactured between 10/21/2022 and 07/04/2024 equipped with a DANA cradle harness

Summary:

Certain Medium Duty (MD) Battery Electric Vehicles may experience intermittent continuity in one or more terminal pins of the C40 connector on the cradle harness, which could potentially result in a loss of propulsion.

Risk:

Intermittent connections in the C40 connector may result in a loss of propulsion, which may increase the risk of a crash.

Remedy:

Inspect the cradle harness connector C40 on all affected vehicles and replace the cradle harness on vehicles that have spread terminals.

Federal Law

It is a violation of Federal law for a dealer to sell or lease new vehicles covered by this recall until the defect or noncompliance has been corrected.

Warranty

Starting on **07/02/2026**, Kenworth will pay for parts at dealer net plus applicable mark-up and labor:

- **1.0 hours** of labor to inspect the C40 connector terminal pins per DANA C40 Connector Inspection procedure (includes photos and the report for **Pass** inspections). Select Recommended Repair Code **26PACBA**.
- **12.5 hours** of labor to inspect the C40 connector terminal pins and replace the cradle harness (includes photos, report, and cradle harness replacement for **Fail** inspections). Select Recommended Repair Code **26PACBB**.
- Attach the email of the supplier communication that includes the photos and the report to the warranty claim.
 - Claims submitted without the attachment of the supplier communication email are subject to denial.
- File an additional claim for extraordinary circumstances. A recommended repair for standard labor must be filed first.
- File the claim within 14 days in accordance with the Warranty Policy.

Take-Off Parts Disposition: Return the failed harness to the supplier (if applicable).

1. After installing the new cradle harness, the faulty harness must be returned to DANA following DANA's warranty return process.
2. Pack the faulty harness into the replacement harness shipping box.
3. Print then pack the completed DANA Cradle Harness Connector C40 Inspection Report form in the

box with the faulty harness.

4. Seal the box, then mark the outside of the box with the claim number and ship to:

DANA Incorporated
Commercial Vehicle Warranty Return Center
6515 Maumee Western
Maumee, OH 43537

PRWS CLAIM CODING			
Campaign Code:	26PACB	Campaign Type	Safety Recall
Claim Category:	Truck	Repair Type	Proactive
Customer Concern Code	062	Causal Code	23
Corrective Action Code	12	Responsibility Code:	CampSupp
Failure Location	046-002-001	Causal Part	CBL1775126
Supplier Code	23031EV	SRT Code	B26-32A 1.0 hours Bulletin 26PACB: Inspect C40 Connector Terminal Pins. Must Complete Inspection Report and send photo B26-32B 12.5 hours Bulletin 26PACB: Inspect C40 Connector and Remove/Replace Cradle Harness

			if C40 Connector Fails Inspection
--	--	--	--------------------------------------

For campaign filing questions, reference Kenworth bulletin CB077.

Procedure



WARNING!

Repair or maintenance procedures may pose a safety risk in limited circumstances. You must read all procedure steps before performing any work and follow all dealership safety procedures or precautions. Failure to comply may result in death, personal injury, equipment damage, or property damage.



WARNING!

Battery Electric Vehicles (BEV) contain high voltage, and the following procedures must be performed by a PACCAR BEV **Level 1** technician. Failure to comply may result in death, injury, equipment damage, or property damage.

1. Inspect the C40 connector per the [Dana C40 Connector Inspection](#).

- **If PASS:**

- Complete the remainder of the **If Pass** section
- Complete the [Dana Cradle Harness Connector C40 Visual Inspection Report](#)

- **If FAIL:**

- Complete the remainder of the **If Fail** section
- Complete the [Dana Cradle Harness Removal and Installation](#)
- Complete the [Dana Cradle Harness Connector C40 Visual Inspection Report](#)

Parts

Parts are only required when the cradle harness requires replacement. Inspect the cradle harness per

the [DANA C40 Connector Inspection](#).

Part Number	Part Description	Quantity
CBL1775126	LV CRADLE HARNESS	1
FAS509201800	BARBED CABLE TIE- DOWNS	13
FAS509200900	ZIP TIE	15
FAS509201300	BUTTON HEAD TIE 105LB 9.6"L BLK	6

Links

[26PACB: Medium Duty Battery Electric Vehicle DANA Cradle Harness Connector - KW Chassis List](#)

[26PACB: Medium Duty Battery Electric Vehicle DANA Cradle Harness Connector - KW Canada](#)

[Customer Letter - English](#)

26PACB: Medium Duty Battery Electric Vehicle DANA Cradle Harness Connector - KW Canada

Customer Letter - French

[Dana C40 Connector Inspection](#)

[Dana Cradle Harness Connector C40 Visual Inspection Report](#)

[Dana Cradle Harness Removal and Installation](#)



A **PACCAR** COMPANY

Kenworth Truck Company
Customer Service Department
C/O PACCAR Parts
750 Houser Way North
Renton, WA 98057
(425) 828-5888

[Date]

Subject: 26PACB: Medium Duty Battery Electric Vehicle DANA Cradle Harness Connector

Transport Canada Recall: 2026-256

Expiration Date: None



IMPORTANT SAFETY RECALL

This notice applies to your vehicle(s) with VIN(s) listed at the bottom or back of this page.

Dear Kenworth Customer:

This notice is sent to you in accordance with the requirements of the Motor Vehicle Safety Act. This is to inform you that your vehicle may contain a defect that could affect the safety of a person.

Kenworth Truck Company has decided that a defect which relates to motor vehicle safety exists in certain vehicle model year 2024 and 2026 K270 and K370 battery electric vehicles manufactured between 10/21/2022 and 07/04/2024 with a DANA cradle harness. These vehicles may exhibit intermittent loss of electrical continuity in one or more terminal pins of the C40 connector on the cradle harness.

What is the problem?

Intermittent loss of electrical continuity in the C40 connector may result in a loss of drive power, which may increase the risk of a crash.

What will your dealer do?

Inspect and replace the cradle harness if necessary, free of charge.

What should you do?

Contact your dealer immediately to schedule a repair. This repair may require up to 13 hours of labor.

To locate your nearest Kenworth dealer, please scan the QR code at the top of this letter or use Dealer Locator at www.Kenworth.com. When scheduling this repair, please refer to recall 26PACB: Medium Duty Battery Electric Vehicle DANA Cradle Harness Connector and the VIN(s) listed in this letter. You may be eligible for reimbursement if you performed this repair before receiving notification of the recall. For more information, please e-mail servicebulletins@PACCAR.com.

If you require further information about this recall or experience any difficulty in making arrangements for this repair, please contact Kenworth Customer Service at servicebulletins@paccar.com and include the bulletin number in the subject line.

If you are the lessor of this vehicle, federal regulations require you to forward a copy of this notice to the lessee within ten days. If you no longer own this vehicle, please email the last 8 digits of the VIN and the new owner's name and address to servicebulletins@paccar.com.



A **PACCAR** COMPANY

Kenworth Truck Company
Customer Service Department
C/O PACCAR Parts
750 Houser Way North
Renton, WA 98057
(425) 828-5888

We appreciate your attention to this matter and value your loyalty to Kenworth and its dealer network.

Sincerely,

Kenworth Customer Service

26PACB: Medium Duty Battery Electric Vehicle DANA Cradle Harness Connector

Number

 [Edit](#)  [Clone](#)

26PACB / Transport Canada: 2026-256

Date

7/2/2026

What's New

Certain Peterbilt Model 220 Battery Electric Vehicle (BEV) chassis equipped with certain DANA cradle harnesses may intermittently lose electrical continuity at one or more C40 connector pins. This can occur without warning and cause loss of propulsion, increasing the risk of a crash.

Certified BEV technicians will inspect the C40 connector and replace the cradle harness, if necessary. This safety recall defect is identical to 25PBD and applies to certain Canadian chassis added on 07/02/2026.

Introduction

Certain Peterbilt Model 220 Battery Electric Vehicle (BEV) chassis equipped with certain DANA cradle harnesses may intermittently lose electrical continuity at one or more C40 connector pins. This can occur without warning and cause loss of propulsion, increasing the risk of a crash.

Certified BEV technicians will inspect the C40 connector and replace the cradle harness, if necessary.

This safety recall defect is identical to 25PBD and applies to certain Canadian chassis added on 07/02/2026.

Situation

2 Canada vehicle model year 2022 and 2025 Model 220 BEV chassis manufactured between 02/25/2021 and 09/22/2023 equipped with a DANA cradle harness

Summary:

Certain Medium Duty (MD) Battery Electric Vehicles may experience intermittent continuity in one or more terminal pins of the C40 connector on the cradle harness, which could potentially result in a loss of propulsion.

Risk:

Intermittent connections in the C40 connector may result in a loss of propulsion, which may increase the risk of a crash.

Remedy:

Inspect the cradle harness connector C40 on all affected vehicles and replace the cradle harness on vehicles that have spread terminals.

Federal Law

It is a violation of Federal law for a dealer to sell or lease new vehicles covered by this recall until the defect or noncompliance has been corrected.

Warranty

Starting on **07/02/2026**, Peterbilt will pay for parts at dealer net plus applicable mark-up and labor:

- **1.0 hours** of labor to inspect the C40 connector terminal pins per DANA C40 Connector Inspection procedure (includes photos and the report for **Pass** inspections). Select Recommended Repair Code **26PACBA**.
- **12.5 hours** of labor to inspect the C40 connector terminal pins and replace the cradle harness (includes photos, report, and cradle harness replacement for **Fail** inspections). Select Recommended Repair Code **26PACBB**.
- Attach the email of the supplier communication that includes the photos and the report to the warranty claim.
 - Claims submitted without the attachment of the supplier communication email are subject to denial.
- File an additional claim for extraordinary circumstances. A recommended repair for standard labor must be filed first.
- File the claim within 14 days in accordance with the Warranty Policy.

Take-Off Parts Disposition: Return the failed harness to the supplier (if applicable).

1. After installing the new cradle harness, the faulty harness must be returned to DANA following DANA's warranty return process.
2. Pack the faulty harness into the replacement harness shipping box.
3. Print then pack the completed DANA Cradle Harness Connector C40 Inspection Report form in the

box with the faulty harness.

4. Seal the box, then mark the outside of the box with the claim number and ship to:

DANA Incorporated
Commercial Vehicle Warranty Return Center
6515 Maumee Western
Maumee, OH 43537

PRWS CLAIM CODING			
Campaign Code:	26PACB	Campaign Type	Safety Recall
Claim Category:	Truck	Repair Type	Proactive
Customer Concern Code	062	Causal Code	23
Corrective Action Code	12	Responsibility Code:	CampSupp
Failure Location	046-002-001	Causal Part	CBL1775126
Supplier Code	23031EV	SRT Code	B26-32A 1.0 hours Bulletin 26PACB: Inspect C40 Connector Terminal Pins. Must Complete Inspection Report and send photo B26-32B 12.5 hours Bulletin 26PACB: Inspect C40 Connector and Remove/Replace Cradle Harness

			if C40 Connector Fails Inspection
--	--	--	--------------------------------------

For campaign filing questions, reference *Peterbilt Warranty Procedure Manual – Section 8*.

Procedure



WARNING!

Repair or maintenance procedures may pose a safety risk in limited circumstances. You must read all procedure steps before performing any work and follow all dealership safety procedures or precautions. Failure to comply may result in death, personal injury, equipment damage, or property damage.



WARNING!

Battery Electric Vehicles (BEV) contain high voltage, and the following procedures must be performed by a PACCAR BEV **Level 1** technician. Failure to comply may result in death, injury, equipment damage, or property damage.

1. Inspect the C40 connector per the [Dana C40 Connector Inspection](#).
 - **If PASS:**
 - Complete the remainder of the **If Pass** section
 - Complete the [Dana Cradle Harness Connector C40 Visual Inspection Report](#)
 - **If FAIL:**
 - Complete the remainder of the **If Fail** section
 - Complete the [Dana Cradle Harness Removal and Installation](#)
 - Complete the [Dana Cradle Harness Connector C40 Visual Inspection Report](#)

Parts

Parts are only required when the cradle harness requires replacement. Inspect the cradle harness per

the [DANA C40 Connector Inspection](#).

Part Number	Part Description	Quantity
CBL1775126	LV CRADLE HARNESS	1
FAS509201800	BARBED CABLE TIE- DOWNS	13
FAS509200900	ZIP TIE	15
FAS509201300	BUTTON HEAD TIE 105LB 9.6"L BLK	6

Links

[26PACB: Medium Duty Battery Electric Vehicle DANA Cradle Harness Connector - PB Chassis List](#)

[26PACB: Medium Duty Battery Electric Vehicle DANA Cradle Harness Connector - PB Canada Customer Letter - English](#)

26PACB: Medium Duty Battery Electric Vehicle DANA Cradle Harness Connector - PB Canada Customer Letter - French

[Dana C40 Connector Inspection](#)

[Dana Cradle Harness Connector C40 Visual Inspection Report](#)

[Dana Cradle Harness Removal and Installation](#)



Peterbilt Motors Company
Customer Service Department
C/O PACCAR Parts
750 Houser Way North
Renton, WA 98057
(425) 828-5888

[Date]

Subject: 26PACB: Medium Duty Battery Electric Vehicle DANA Cradle Harness Connector

Transport Canada Recall: 2026-256

Expiration Date: None



IMPORTANT SAFETY RECALL

This notice applies to your vehicle(s) with VIN(s) listed at the bottom or back of this page.

Dear Peterbilt Customer,

This notice is sent to you in accordance with the requirements of the Motor Vehicle Safety Act. This is to inform you that your vehicle may contain a defect that could affect the safety of a person.

Peterbilt Motors Company has decided that a defect which relates to motor vehicle safety exists in certain vehicle model year 2022 and 2025 Model 220 battery electric vehicles manufactured between 02/25/2021 and 09/22/2023 with a DANA cradle harness. These vehicles may exhibit intermittent loss of electrical continuity in one or more terminal pins of the C40 connector on the cradle harness.

What is the problem?

Intermittent loss of electrical continuity in the C40 connector may result in a loss of drive power, which may increase the risk of a crash.

What will your dealer do?

Inspect and replace the cradle harness if necessary, free of charge.

What should you do?

Contact your dealer immediately to schedule a repair. This repair may require up to 13 hours of labor.

To locate your nearest Peterbilt dealer, please scan the QR code at the top of this letter or use Find a Dealer at www.Peterbilt.com. When scheduling this repair, please refer to recall 26PACB: Medium Duty Battery Electric Vehicle DANA Cradle Harness Connector and the VIN(s) listed in this letter. You may be eligible for reimbursement if you performed this repair before receiving notification of the recall. For more information, please e-mail servicebulletins@PACCAR.com.

If you require further information about this recall or experience any difficulty in making arrangements for this repair, please contact Peterbilt Customer Service at servicebulletins@paccar.com and include the bulletin number in the subject line.

If you are the lessor of this vehicle, federal regulations require you to forward a copy of this notice to the lessee within ten days. If you no longer own this vehicle, please email the last 8 digits of the VIN and the new owner's name and address to servicebulletins@paccar.com.



Peterbilt Motors Company
Customer Service Department
C/O PACCAR Parts
750 Houser Way North
Renton, WA 98057
(425) 828-5888

We appreciate your attention to this matter and value your loyalty to Peterbilt and its dealer network.

Sincerely,

Peterbilt Customer Service