



SSM 55009 2021-2026 Bronco – “Park Brake Limited Function Service Required” Message In The IPC

Some 2021-2026 Bronco vehicles may exhibit a “Park Brake Limited Function Service Required” message in the instrument panel cluster (IPC). This may be due to an issue with the driver door harness connector after removing and installing the removeable doors. If diagnostic trouble code (DTC) B1626:29 is stored in the driver door module (DDM), inspect connector C322C between the upper and lower door hinges that attaches to the body for proper installation and/or pin fitment. Repair as necessary. If the condition was caused by improper door installation, do not submit a claim for this condition. If no concerns are found with the connector, refer to Workshop Manual (WSM), Section 501-11 > Diagnosis and Testing for normal diagnostics.