



Service Bulletin

Bulletin No.: PIT6376B

Date: July, 2026

PRELIMINARY INFORMATION

Subject: Police Tahoe Aux Battery Disconnected DTC B1C6D

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Tahoe	2025		All	All	All	All

Involved Region or Country	North America
Additional Options (RPO)	K6K, 9C1, 5W4
Condition	Dealer may notice during PDI the aux battery is disconnected and DTC B1C6D SYM12 and B1C6D SYM13 are set current in the BCM.
Cause	The assembly plant intentionally leaves the aux battery disconnected and during PDI process it should be connected.

Correction

Vehicles with auxiliary battery in the rear cargo area will need the battery sensor attached to the battery and LIN connected to the battery sensor, Per the PDI sheet.

DTCs B1C6D Symptom 12 and 13 are known false-setting DTCs and should be disregarded.

If the vehicle exhibits no symptoms other than these DTCs being stored, they are considered false and do not require any corrective action. These DTCs will not cause any warning messages, MIL illumination, or other vehicle performance concerns. The auxiliary battery system will operate properly. If no additional symptoms are present, no further diagnosis is necessary for these codes.

Version	3
Modified	05/05/2025 - Created on 05/11/2026 - Updated Correction 07/17/2026 - Updated Correction

